

ADD: 5th floor No. 4 building No. 4 Yard Zhongguanyuan Road, Zhongguancun Life Science Park, Beiqing St., Changping District, Beijing, China

P.C.: 102206 TEL: 010-53275118 FAX: 010-53275119

Thank you for choosing the products!

This manual helps you be familiar with the company's products, and get information about systems' components, configuration, etc.

This manual detailed knowledge of the system characteristics, operational processes, installation, commissioning, and safety precautions. Please read this manual carefully before using the system and machine, which will help you use it better.

Cautions:

- Use of this product is strictly prohibited in the strong interference, strong magnetic field environment. Operating ambient temperature 0-70 °C, working environment humidity 0-90% (non-condensing).
- 2. Insert U disk in the correct direction.Do not pull out 50-pin cable when system run.
- 3. During processing U disk file process, do not pull out the U disk to prevent the interruption of data transmission.
- 4. Strictly prohibited metal, dust, and other conductive substances enter the controller.
- 5. The machine shell should connect the ground wire to ensure the safety of the work and to prevent interference.
- 6. Prohibited unauthorized disassembly, no user-repairable parts..
- 7. Unused for long periods of time, please pay attention to the power outage, and keep properly.
- 8. Pay attention to water, dust, fire when using it.
- 9. Do not use the corrosive chemical solvents to clean the equipment.
- 10. Spindle motor bearing life and its speed is inversely proportional.
- 11. Graver is very sharp. Do not touch when it is running in order to avoid injury; Do not use handkerchiefs, scarves to touch it to prevent embroiled damage.

Important Notice:

The Company shall not be responsible for any loss caused by improper using or breaking the correct operating procedures.

Beijing RichAuto S&T co.,Ltd owns this manual final interpretation,the company reserves the right to modify all information in this manual, including data, technical details, etc..

Contents

	Foreword	1
1.	RichAuto system composition	3
1.1	System composition	3
1.2	Description of each component	4
1	2.1 Handle	4
1	2.2 Interface board	5
1	2.3 50-pin data transmission cable	5
1	2.4 USB communication cable	5
1.3	Interface board shell size	6
1.4	System start-up mode	6
2.	Handle buttons introduction	6
2.1	Buttons introduction	6
2.2	Usage mode	7
2.3	Detail information for buttons function	8
3.	Wiring Instructions	9
3.1	RichAuto interface board description	9
3.2	Interface board I / O description	10
3.3	Hardware wiring	12
3.4	Commissioning of the machine and control system	
4.	Menu Description	16
4.1	Menu category	16
4.2	Menu details	16
4	2.1 MACHINE SETUP	16
4	2.2 AUTO PRO SETUP	20
4	2.3 SYSTEM SETUP	23
	2.4 OPERATE FILE	
4	2.5 VERSION VIEW	28
5.	Machine Operation	

5.1	Return home	29
5.2	Import processing files	29
5.3	Manual operation	29
5.3.	1 Manual speed switching and adjusting	33
5.3.	2 Manual mode	34
5.3.	3 Manual testing input and output	34
5.3.	4 Manual switching coordinate system	33
5.4	Automatic processing operation	33
5.4.	1 Set workpiece origin	33
5.4.	2 Choose processing file	34
5.4.	3 Set processing parameters	34
5.5	Operations during processing	35
5.6	Advanced Processing	38
5.6.	1 Array work	33
5.6.	2 Resume work	34
5.6.	3 Tool changing	34
5.6.	4 Part work	33
5.6.	5 Calculate bound	33
5.6.	6 Mill plane	34
5.6.	7 Calculate work time	34
5.6.	8 Find break no	33
5.6.	9 Scale work	33
6. A	A12 Plasma Cutting Motion Control System	44
6.1	Handle and buttons introduction	44
6.2	Output description.	44
6.3	Arc setup&wiring	44
6.4	Parameters description	46
7. A	15Multi-spindle Motion Control System	47
7.1	Handle and buttons introduction	47
7.2	Output description.	47

7.3 Spindle wiring
7.4 Multi-spindle setup
7.5 G code example
8. A18Four-axis Linkage Motion Control System
8.1 Handle buttons introduction
8.2 Input description
8.3 Parameters description
8.4 G code example53
9. Appendix
9.1 System upgrade
9.2 U-disk Function
9.3 Servo driver parameters
9.3.1 YASKAWA Σ-7、Σ-V
9.3.2 PANASONIC MINAS A5
9.3.3 DELTA ASDA-A2&B2
9.4 G code list
9.5 Tool setting(Tool measurement)
9.5.1 Fixed calibration65
9.5.2 Mobile calibration67
9.6 Calculate pulse equivalent
9.6.1 Stepper driver
9.6.2 Servo driver
9.6.3 Proportion calculation method
9.7 Common problems and troubleshooting70
9.7.1 Solutions of the faults display on the screen76
9.7.2 Faults in practical operation
9.7.3 Electrical components and wiring problem80

> Foreword

1) System Introduction

RichAuto A1X motion control system independently developed by Beijing RichAuto S&T Co., Ltd and it can be widely applied to machinery, advertisement, woodworking, mold engraving machines, laser, flame, plasma cutting machines, and others in the machine control field.

RichAuto A1X make DSP as the core of the system, High-speed processing; Use embedded structure, high degree of integration and strong stability make installation and operation easy; Support U disk, removable storage card reader; High speed transfer, no longer dependent on the computer to realize off-line operation.

2) Characteristics

- Adopting position control mode, support 3-axis and 4-axis linkage motion control, double Y drive.
- 2. Standard with 8 Input/Output interface board.
- 3. Support various processing format, such as G code, PLT, bitmap and DXF etc.
- 4. Intelligent memory function, support power failure protection and breakpoint processing function.
- 5. Support portable storage mode function.
- 6. Multi-coordinate memory function. Provide 9 work coordinates system, the user can switch among the 9 coordinates, each coordinate system can save a process origin information.
- 7. Support adjusting spindle frequency during processing. The spindle frequency from 0 to maximum frequency is divided into 8 gears, 1 8 gear can be processed directly adjust up and down without suspend processing.
- 8. Support adjusting speed ratio during processing. Users can adjust the speed ratio from 0.1-1, ascending or descending per 0.1 numerical.
- 9. Simple manual operation mode.Including —Continue,Step,Dist", manual operation becomes more simple and convenient.

- 10. Support M,F code and other expanded codes, special code can be customized according to actual request.
- 11. Built-in 512 Mb memory. Communication by USB interface.
- 12. Unique handheld form to realize holding by one hand. Liquid crystal display and 16 buttons make operating intuitive and flexible. No longer dependent on the computer to realize off-line operation.
- 13. Self-test function, system supports I/O signal detection capabilities to make remote maintenance easy.
- 14. Support multiple languages, such as Spanish, French, Arabic, etc.
- 15. System supports automatically dynamic upgrading that make remote operation and remote maintenance convenient.

3) Product Parameters

Product Model	RichAuto-A1X		
CPU	DSP	Power Failure Protection	Support
Built-in Memory	512Mb	Breakpoint Processing	Support
		Function	
Screen	128*64 Monochrome	Power Supply	DC 24V
	Screen		
Communication Port	U Disk	Manual Mode	Continue, Step,
			Distance
Number of Linkage Axes	3-4 axes	Interpolation Method	Line, Arc, Spline
Control Signal	Common Anode Soft/Hard Limit		Support
Drive System	Stepping/Servo Motor Maximum Pulse Free		1MHz
Minimum Input Unit	0.001mm	Password Protection	Support
Language	Simplified/Traditional Chinese,English,Other languages can be		nguages can be
	customized		
Standard Configuration	DSP Handle; 50-pin Cable、8 I/O Interface Board, USB Cable		

4) Product Model

	Model	Name
	A11	Three-axis Linkage Motion Control System
	A12	Plasma Cutting Motion Control System
	A14	Dispensor Motion Control System
AutoNow	A15	Multi-spindle Motion Control System
A1X Motion Control	A115	Double Z Motion Control System
System	A16	Side-spindle Motion Control System
	A18	Four-axis Linkage Motion Control System
	A123	Four-axis Linkage + Multi-spindle Motion
		Control System
	A132	Lathe Motion Control System

1. RichAuto System Composition

1.1 System composition

RichAuto control system contains the following parts: handle, interface board, a 50-pin data transmission cable, an USB communication cable.



Handle



50-pin data transmission cable



Interface board



USB communication cable

1.2 Description of each component

1.2.1 Handle


As shown below, including 6 parts:



- 1) Screen: 128 * 64 resolution LCD to display the machine motion, system settings and other information.
- 2) Button board: Contains 16 buttons to input system parameter information and operate the machine.
- 3) U-disk interface: Interface of U-disk (FAT16/32) and the memory card.
- 4) Company LOGO: RichAuto.
- 5) 50-pin data cable interface: Connect the handle with the interface board to realize controlling the machine. Including 2.5 m, 4 m, and 6 m.
- 6) USB cable interface: It is used to connect the handle with your computer.

1.2.2 Interface board

As shown below, including 5 parts:

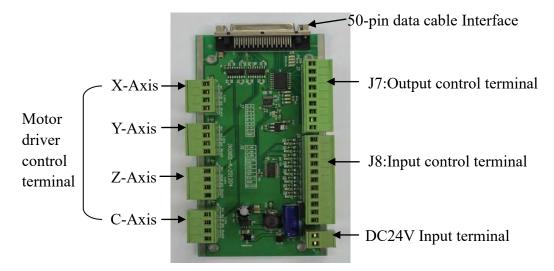

- 1) 50-pin data cable port: connect handle with interface board.
- 2) Output control terminal: including spindle On/Off signal,work&alarm led siganl etc..
- 3) Input control terminal: including machine origin detection switch, toolsetting, driver alarm, hard limit switch, and E-stop signal, pedal switch.
- 4) Power supply terminal: DC24V,3A
- 5) Motor driver control terminal.


1.2.3 50-pin data transmission cable



1.2.4 USB communication cable



1.3 Interface board shell size

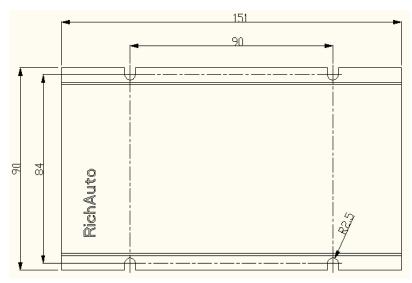

Ratio:1: 1, Unit: mm

1.4 System start-up mode

Normal start: After power up, the system enters the homing type interface and manual control interface.

Emergency start: After power up, if the system can not enter the homing type interface and manual control interface, users need to make an emergency start operation.


Firstly, cut off the power supply, and then press and hold button "ORIGIN OK", power up again,

after 3-4 seconds, release button "OK", if system enters the Emergency state, you can choose to "Update System", "Format System", and then restart the system.

2. Handle Buttons Introduction

2.1 Buttons introduction

RichAuto motion control system defines 16 buttons according to functional requirements. Each button has one or more functions under different work status.

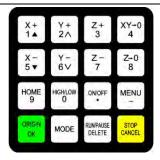

Buttons picture

2.2 Usage mode

RichAuto control system provide two modes of buttons' operation, including one-touch button & Combination button.

One-touch button: Press one button on handle.

Combination button: Press two buttons at the same time to achieve the operation; the operation step: press one main function button and meanwhile press a second accessibility button, and then release the two buttons at the same time to realize the combination button operation.

List of Combination buttons:

	Combination button	Function
1	MENU	Switch the coordinate system (0 for the
		mechanical coordinate system, 1 - 9 for
		the work coordinate system)
2	MENU ON/OFF ""	Start Z-axis automatic tool setting
3	RUN/PAUSE	Start the breakpoints processing (support
	DELETE "+-1—8" Number Buttons	number 1 - 8)
4	RUN/PAUSE HIGH/LOW O	Start advanced processing
5	ON/OFF $\begin{bmatrix} Z+\\ 3 \end{bmatrix} \begin{bmatrix} Z-\\ 7 \end{bmatrix}$	To switch gear shaft under manual mode
6	RUN/PAUSE HOME 9	Repeat last time processing

7	MODE 3" + Z+0 8	Set stop position
8	MENU ORIGIN OK	System upgrade
9	ORIGIN STOP CANCEL	Quit buttons check


2.3 Detail information for buttons function

Name	Function		
X+ 1▲	Positive movement of X axis, menu upward, figure 1 inputting		
Y+ 2∧	Positive movement of Y axis, speed-up processing speed, figure 2 inputting		
Z+	Positive movement of Z axis, figure 3 inputting, increase spindle speed		
3	during processing		
C+ XY→0 4	Set X axis and Y axis work origin, figure 4 inputting		
X − 5 ▼ Negative movement of X axis, menu downward, figure 5 inputtion			
Y- 6V	Negative movement of Y axis, solw down processing speed, figure 6		
6∨	inputting different property selecting in Menu		
Z-	Negative movement of Z axis, figure 7 inputting, reduce spindle speed		
7	during processing		
Set Z axis work origin, figure 8 inputting			
HOME 9	Machine back home, figure 9 inputting, check information during processing		
HIGH/LOW	High or low speed selection under manual mode, figure 0 inputting, change		
0	work coordinate & mechanical coordinate during processing		

ON/OFF	Spindle start/stop, decimal point inputting		
MENU -	Enter menu setting, negative sign inputting ,check information during processing		
ORIGIN OK	Back to work origin,confirm motions /inputting/operating		
MODE	Manual mode, continue/step/distance to select		
RUN/PAUSE	Run or pause processing, delete inputting data, different property selecting in		
DELETE	menu		
STOP	High/low speed parameter adjust under manual mode, quit process stop/selections, inputting and operating cancel		

3. Wiring Instructions

3.1 RichAuto interface board description

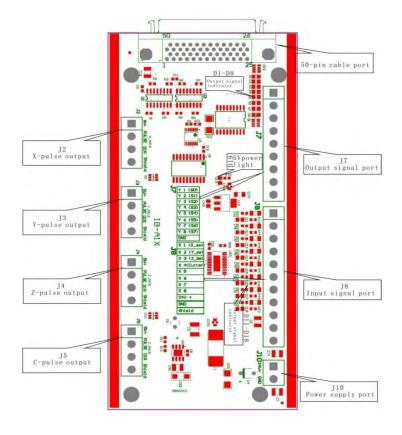



3.2 Interface board I / O description

Port Port Signal description Pin fu		Pin functions	Notes	
lable	definition		and parameters	
DC24V	24V+	+24V DC power input	Supply DC24V for	24V (≧3A)
24V	24V-	Power GND	interface board	
	5V	Common anode	Output 5V	Do not impose voltage on this pin
X_AXIS	PULSE	X axis pulse signal	Output voltage ≥ 3V; Drive current ≤ 8mA	
SI	DIR	X axis direction signal	Output voltage ≥ 3V; Drive current ≤ 8mA	
	SHIELD	Shielded signal		Do not impose voltage
	5V	Common anode	Output 5V	Do not impose voltage on this pin
Y_AXIS	PULSE	Y axis pulse signal	Output voltage ≥ 3V; Drive current ≤ 8mA	
SI	DIR	Y axis direction signal	Output voltage ≥ 3V; Drive current ≤ 8mA	
	SHIELD	Shielded signal		Not GND
	5V	Common anode	Output 5V	Do not impose voltage
Z_A	PULSE	Z axis pulse signal	Output voltage ≥ 3V; Drive current ≤ 8mA	
AXIS	DIR	Z axis direction signal	Output voltage ≥ 3V; Drive current ≤ 8mA	
	SHIELD	Shielded signal		Not GND
	5V	Common anode	Output 5V	Do not impose voltage on this pin
C_AXIS	PULSE	C axis pulse signal	Output voltage ≥ 3V; Drive current ≤ 8mA	
IS	DIR	C axis direction signal	Output voltage ≥ 3V; Drive current ≤ 8mA	
	SHIELD	Shielded signal		Not GND



Port	Port	Signal description	Pin functions	Notes
lable	definition		and parameters	
	Y01	FWD/REV	Logic low	Connect FWD&DCM, do
	Y02	Multi-Speed 1	Logic low	not connect Y01
	Y03	Multi-Speed 2	Logic low	
00	Y04	Multi-Speed 3	Logic low	
OUTPUT SIGNAL	Y05	Alarm indicator	Logic low	
JT S	Y06	Run indicator	Logic low	
IGN	Y07	deifnable	Logic low	
[AL	Y08	deifnable	Logic low	
	24V	Output DC 24V	Output 24V	Supply DC24V for indicators
	GND	GND		
	SHIELD	Shielded signal		
	X01	X Machine zero	Logic low	For external connection with mechanical,photoelectrical or proximity switch
	X02	Y Machine zero	Logic low	For external connection with mechanical,photoelectrical or proximity switch
	X03	Z Machine zero	Logic low	For external connection with mechanical, photoelectrical or proximity switch
NPU	X04	Tool setting	Logic low	
INPUT SIGNAL	X05	Driver alarm	Logic low	
GN.	X06	Hard limit	Logic low	
T	X07	E-stop	Logic low	
	X08	Pedal switch	Logic low	Pause during processing&repeat after processing
	24V	Output DC 24V		For active sensors
	GND	GND		For active sensors
	SHIELD	Shielded signal		



3.3 Hardware wiring

Installation Requirements: Power (24V, 3A), it is better to add a filter to prevent the electric field interference. If choosing origin detecting switches of different power supply type, the special testing switching power is needed. (24V origin detecting switch is the best choice)

 
RichAuto control system realizes its control through the connection between the interface board and CNC machine. Interface board terminal can be divided into input terminal and output terminal

Input terminal: INPUT SIGNAL DC24V(Power Supply)

Output terminal: X,Y,Z,C axis pulse signal output terminal,OUTPUT SIGNAL


Input terminal

Power Supply




INPUT SIGNAL

1. Machine Origin Y and Z are the same as X

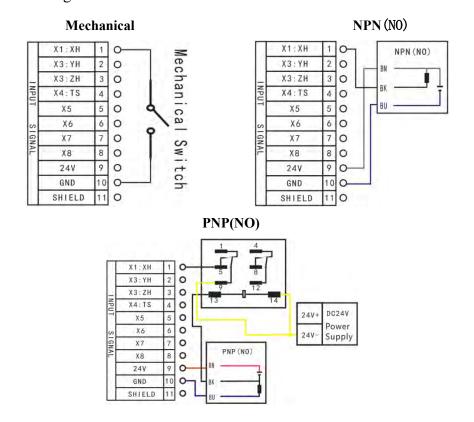




2. Tool-setting input

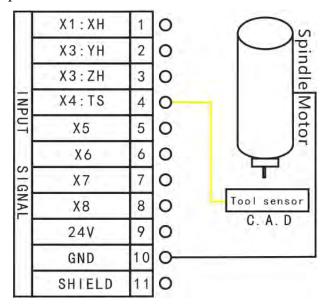


3. X5-X8 e.g.-Servo alarm

Alarm signal normal open, wiring in series (modify the definition of X5 level.

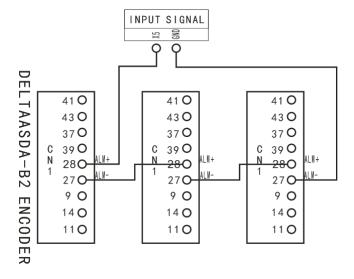

Alarm signal normal open, wiring in parallel

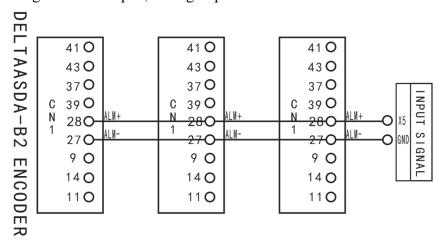





Output terminal

X pulse signal wiring Y and Z are the same as X

Stepper driver:

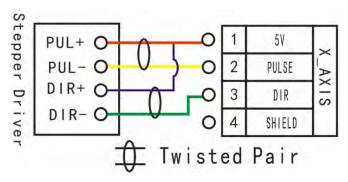


Servo driver: Σ -7 same as Σ -V

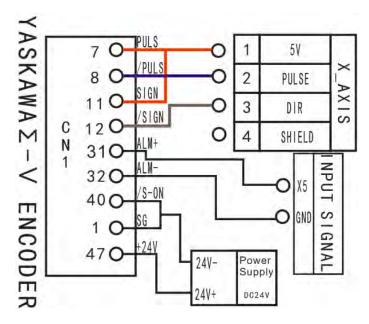

Motor Brake: YASKAWA Σ - V(Σ -7 same as Σ -V),Set Pn50F=0300

Wired as follows:

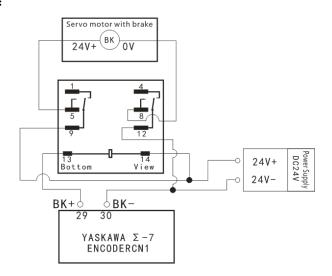



OUTPUT SIGNAL Y1-Y4

Count 3-2 Count 3-1 Y1 0 FWD Y2 0 Y2 0 O OUTPUT SIGNAL 3 Y3 0 Y3 rte Y4 4 0 Y4 Multi-Speed FWD Y5 Y5 0 0 DCM 6 Y6 0 Y6 0 Y7 Y7 0 0 Y8 8 0 Y8 0 9 GND GND Count 1(ON/OFF) **Spindle State** Spindle ON/OFF Y1 FWD 1Shift ţ 2 t Y2 2Shift 0 Spindle Υ3 3 1Shift 0 ţ 2Shift t Y4 4 0 3Shift ŧ t Y5 5 0 DCM 4Shift t ŧ Y6 6 0 Count 5Shift ŧ t 7 Υ7 0 ţ 6Shift 8 Y8 0 7Shift ŧ t t

CAUTION: FWD and DCM has Connected in Parallel in some inverters, plesae do not need to connect Y1 in such situations, you only need to connect DCM with GND of interface board, without having to reset the spindle gear.


8Shift

t

OUTPUT SIGNAL Y5-Y8

9

GND

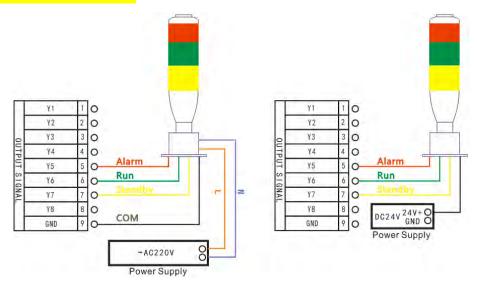

You can connect the machine with the control system when the above setting is over.



3.4 Commissioning of the machine and control system


- 1. After turn on the power, users can manually move each axis and confirm the direction. If the movement direction and definition direction are opposite, users can change the motor phase sequence (A+, A-/B+, B-) or modify servo parameters.
- **2.** According to the original location of the machine coordinates, users can enter into menu-machine setup-home setup-home direction to reset it.
- 3. Double-press "-manual voltage setup (the upper arrows stand for input voltage) to check whether the home switch is working.

The machine is in good connection if all the above setting is ok.

4. Menu Description

4.1 Menu category

According to menu function, RichAuto sytem menu divided into:

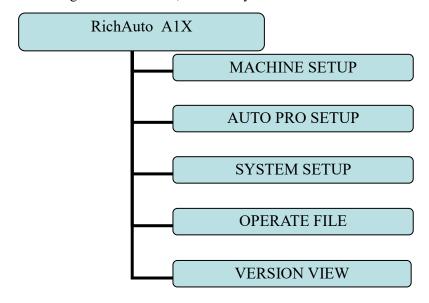

4.2 Menu details


4.2.1 MACHINE SETUP

Users can set the parameters about machine hardware under"Machine Setup". It is set by



machine producer according to device type. If machine hardware parameter is not changed, this parameter should also not change. If machine users need to change, please consult machine producer.

Machine setup chart

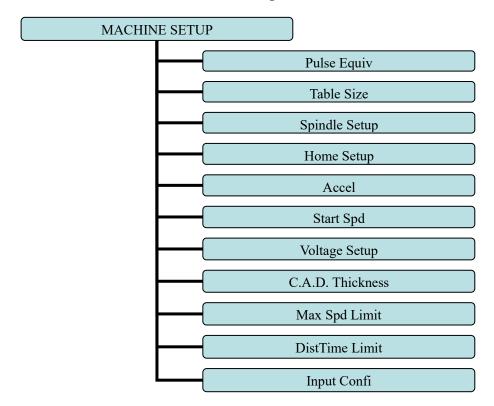

1. Pulse Equiv

Linear axis: The number of pulses of the system needs to send when machine moves every 1mm.Unit: pulse/mm.

Rotary axis: The number of pulses of the system needs to send when machine turns every 1 angle. Unit: pulse/angle.

Calculation methods are detailed in Appendix 7

Setting: Enter —plse equiv", cursor is in the X-axis pulse equivalent position, press

X + 1 ▲

X -

The sequivalent position, press to move cursor to where users want to modify. Press —

The sequivalent position, press to move cursor to where users want to modify. Press —

The sequivalent position, press to move cursor to where users want to modify. Press —

The sequivalent position, press to move cursor to where users want to modify. Press —

The sequivalent position, press to move cursor to where users want to modify. Press —

The sequivalent position is in the X-axis pulse equivalent position, press to move cursor to where users want to modify. Press —

The sequivalent position is in the X-axis pulse equivalent position, press to move cursor to where users want to modify. Press —

The sequivalent position is in the X-axis pulse equivalent position, press —

The sequivalent position is in the X-axis pulse equivalent position is in the X-axis pulse equivalent position. The sequivalent position is in the X-axis pulse equivalent position is in the X-axis pulse equivalent position. The sequivalent position is in the X-axis pulse equivalent position



2. Table Size

RichAuto system make the table size as the soft limit values, in order to prevent machine



move over travel, machine size must be less than or equal to the value of the actual motion displacement machine.

3. Spindle Setup

Spindle delay: Unit: ms; including start delay and stop delay.

Spindle state: Used to set Spindle states ---multi-speed or only on/off status. See detailed settings at **OUTPUT SIGNAL**-spindle output wiring.

4. Home Setup

Home speed: Every axis movement speed when back home, system default speed X.Y: 3000 mm/minute, Z: 1800 mm/minute.

Home order: Every axis movement order when back home

Including:

- \diamondsuit Z.X and Y Z.X.Y Z.Y.X
- \Leftrightarrow Z only X and Y,Z X,Y,Z
- \diamondsuit Y,X,Z XY home X,Y home
- ♦ Y,X home None home X home only XZ and Y

Home direction: Every axis movement direction when back home, this direction depends on the position where home switch is on the machine. If home switch installed in the positive direction, so home direction should be -positive", and vice versa.

5. Accel (Acceleration) Unit: mm/s2

The maximum acceleration value during acceleration and deceleration movement, improve (including straight and curved motion) processing capabilities. If acceleration is too large, it may cause the motor losing steps, jitter and even whistle, if too small, it will lead to accelerated slowly



and reduce the operating speed of the entire graph. System default:linear acceleration is 800 mm/s^2 , curve acceleration is 1000 mm/s^2 , the proposed curve acceleration is 1-1.5 times the linear acceleration value.

6. Start Speed Unit: mm/minute


The speed of axis started directly from standstill. Not starting from zero speed, but starting directly from a certain speed, so it can shorten the overall processing time, but do not set this speed too high. Set too high, it will cause the motor losing steps, jitter and even whistle; Set too small, it will reduce the operating speed of the entire graph. If the inertia of motion axes (axis heavier), users can set a smaller start speed, if the inertia of motion axes smaller (lighter shaft), users can set it bigger.

7. Voltage Setup

Set input and output signal terminal status, \(\ddot\)" means normal open, \(\ddot\)" means normal closed. Including two rows of arrow:

The upper arrow indicates the input level: Set input signal level. The top four: 0,1,2,3 positions correspond X, Y, Z axis back home, toolsetting signal; 4-7: driver alarm, hard limit, E-stop signal, pedal switch.

The under arrow indicates the output level: Set output signal level. The top four: 0, 1, 2, 3 positions correspond spindleOn/Off, multi-speed 1, multi-speed 2, multi-speed 3 signal, 5, 6:4, 5 positions correspond alarm indicator, work indicator signal.

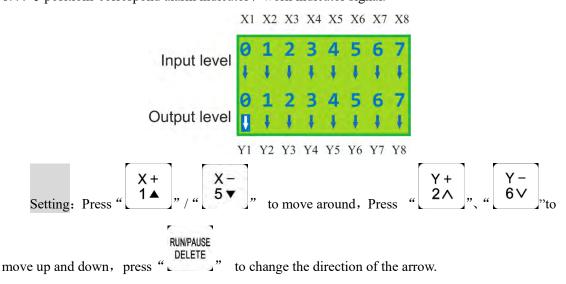

8. C.A.D.(Tool sensor) Thickness Unit: mm

This thickness should input by actual, if it is bigger than the actual thickness, Z axis may cut



too much;if smaller, Z axis can't touch workpiece. This parameter can only take effect when user use auto toolsetting function.

9. Max Spd Limit (Max Speed Limit) Unit: mm/minute


Set machine top speed, it only takes effect during processing, system default max speed X,Y is—60000000 mm/minute", –Z+" is –1800 mm/minute", –Z-" is –3000 mm/minute".

10. DistTime Limit Unit: second

Users select diatance mode,and if the machine does not move in a certain period of time(system default is 30 seconds),the system will go back to continuous mode to prevent Z-axis collision risk because of the customer forgot to switch back to continuous mode and set a large distance value.

11. InputConfi (Input Port Configuration)


To open or prohibit input signal, if the interface board does not connect X5-X8 signals, users can prohibit X5-X8 signals.

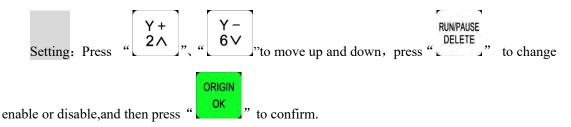

4.2.2 AUTO PRO SETUP

Users can set the parameters about processing under"AUTO PRO SETUP".

Auto Pro Setup chart

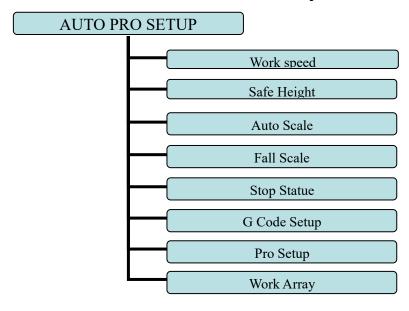



1. Work Speed Unit: mm/minute

Including work speed and fast speed, system default is 3000 mm/minute.

2. Safe Height Unit: mm

The height of Z axis rise during processing. System default is 40.000 mm.

3. Auto Scale

Actual processing speed=work speed*auto scale, system default auto scale does not affect the fast speed.


4. Fall Scale

Fall scale, system default is 0.200.fall speed=fast speed*fall scale, the maximum fall speed is Z axis negative limit speed*fall scale.


Fall height, system default is 5.000mm, fall down scale takes effect when the spindle falls to the fall height.

5. Stop Statue

Setup stop position after auto processing.

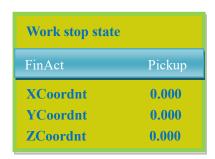

(Coordnt=coordinate)

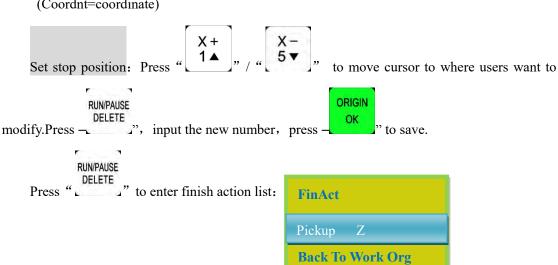

Back Home Back Position

None move

(FinAct=Finish Action, Org=Origin)



Press " X + 1 = 0 X - 1 =

to save.


6.G Code Setup

Set special G code attribute, according to the actual need to make changes.




(Ign=Ignore, Adj=Adjt=Adjust, AbsCntr=Absolute center)

CAUTION: Blue parts indicate system default attributes.

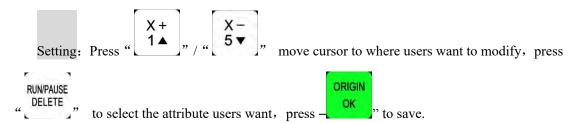

7. Pro Attribute

Set some special settings about processing according to the actual need.

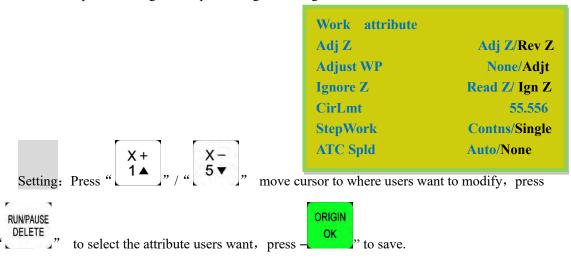



8. Work Array

Set array parameter,including columncount,Rowcount,Columnspace,Rowspace,Interval (unit: ms)

Columnspace: File spacing of X direction

Rowspace: File spacing of Y direction


Total Processing times= columncount* Rowcount

Interval: System default 0, it means no wait.

During processing, if users need to change processing materials after completion of each processing, you need set time interval a negative number. When the first time processing is completed, the screen prompt: waiting for the next array processing, press any key to start the next array processing at this time, if not press, system keep waiting.

4.2.3 SYSTEM SETUP

System Setup Chart

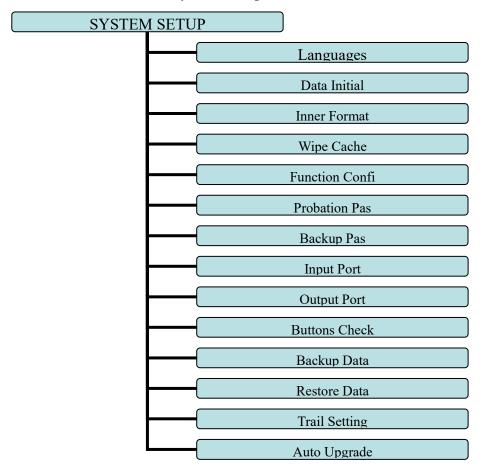



1. Languages

Change system display language, users can choose Chinese and English.

2. Data Initial

After data initial system parameters will restore to factory setting.

3. Inner Format

Wipe the internal files, it will not damage the system parameters.

4. Wipe Cache


Users need to do this after functional upgrade, such as change four-axis program to three-axis program, users must do this operation. After this operation , users need to restart the system.

5. Function Confi (Function Configuration)

Set whether the system retain a function or not, change it according to the actual application in accordance with the practical application of changes. After the operation users need to restart the system.



CAUTION: Blue parts indicate system default function.

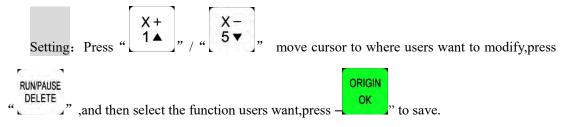


6. Probation Pas (Probation Password)

If engraving machine manufacturers setting some kinds of passwords before shipment (including probation password and backup password, etc.), if you forget the original password, you can connect our company and tell us 20-digit here, our company will provide you a new



20-digit password, you need enter the new 20-digit password, and then all the passwords will be cracked.

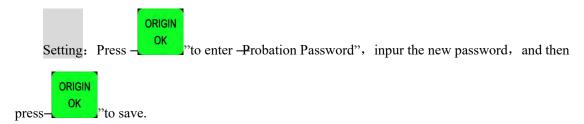

7. Backup Pas (Backup Password)

Prevent users overwritten the original correct parameters in the parameter backup disorder or misuse case. To cancel, you do not input any number when you are prompted to enter a new



8. Input Port(Input Port List)

- 1-3:X,Y,Z home signal 4: Tool setting input signal
- 5-8:Driver alarm, Hard limit, E-stop, pedal switch signal

9. Output Port(Output Port List)

- 1: Spindle On/Off signal 2-4: Spindle speed signal 5: Alarm indicator signal
- 6: Work indicator signal

10. Buttons Check

Users can check buttons are valid or not under this menu. Enter "Buttons Check", press every

button, if it is valid, the screen will highlight. Exit "Buttons Check", press "

ORIGIN OK "

CANCEL "

"+"

11. Backup Data

Backup system parameters to U disk or inner, format system can't effect this. File format: data.bak.

12. Restore Data

Restore backup data from U disk or inner to system.


13. Trial Setting

Including Four levels password, password and using time can be set in every level respectively. Password can be setted to be 1-8 digits; using time unit: hour, system default 1. The




password work according to top-down order, if you do not set trial 1 password, only set trial 2-4, it will work according to 2-4 order.

The operation of Data Initial, Inner Format, Wipe Cache should not crack the password.

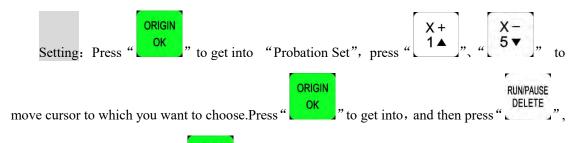

input the new number, press—"to save. The screen displays:

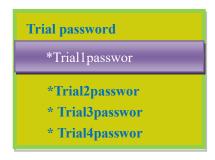

There is a mark "*" before every level password, if not, the password will not work normally.

If you have setted all passwords, press "

stop CANCEL

, the screen will display:

You must restart the system after setting trial password.

When password expires, the screen will display:

The system is out of testing time, please contact the factory to get more testing time or unlock!

Connect engraving machine manufacturers to get password, press "OK", the screen wil display:

ORIGIN

Please input trail 1 password:



Enter the password, press "to save. The screen will display:

The time password is updated successfully,please restart the control system.

Restart the handle, and system will work normally.

NOTE: If engraving machine manufacturers forgot all password, you can contact our company and tell us 20-digit original password under "SYSTEM SETUP-Probation pas", we will

 
ORIGIN

provide the new 20-digit password, entered the new number, and press "OK" to confirm After Cracking Password, restart the handle, and then you can work normally.

14. Auto Upgrade


If the system has new function, our company will provide upgrade file (extension ******.

PKG & shown as rz-xxxx), users can upgrade through the U disk, specific steps in Appendix 1. It will not damage the original parameters.



4.2.4 OPERATE FILE

Operate File Chart

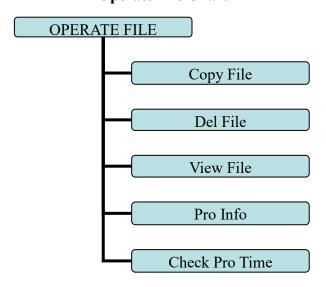

1. Copy File

Copy files from U disk to Inner.



2. Del File (Delete File)

Delete files of inner.

3. View File


View the files and G codes of U disk or inner.

4. Pro Info (Processing Information)

System power on, it will statistical the times of successful processing by file name, if system power off, the data will disappear.

5. Check Pro Time (Check Processing Time)

Calculate processing time by system work speed, after reading G code, the screen will display the processing time, different work speed corresponding to different processing time.

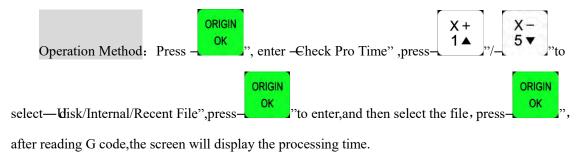


CAUTION: Plesae pull out the U disk correctly after copying files from computer, if not, the controller may not recognize the U disk.

Win7(32 bit) system: after copying files, please press—", and then the display will show

Open Devices and Printers

Fject Cruzer Blade

 ", choose the device to be shut down. when the display shows:



2) Win XP system: after copying files, please press—", and then the display will show

— Safely remove USB Mass Storage Device - Drive(Ht) , choose the device to be shut down. when the display show — Safely Remove Hardware , the U disk pull out from computer successfully.

4.2.5 VERSION VIEW

Users can view information about the system hardware and software, including:



Update Version eg: P1.409/rz-xxxx/q10-82 Product ID eg: A0020112

Soft Version eg: A1.1936 Emergency Version eg: A1.1920

Soft type: 3-axis carving Hardware type: Support 3-inch screen Support Flash Disk Mode

5. Machine Operation

5.1 Return home

It will display **—all axis home**", **—Z home only**", **—none axis home**" after starting up the DSP handle. Choose any one you want. Machine return home can correct the coordinate of system.

In some cases, such as after normal power off, reboot ad continue last operation, user no need to reset machine, just choose **—none axis home**". That is because system auto save coordinate value when system quit.

5.2 Import processing files

 
Before processing, generally we should import files. RichAuto system has 2 ways for processing: U disk file processing, inner file processing.

- 1. Directly import the processing file into U disk, then run the handle.
- 2. Copy the process file to inner memory space via U disk.

5.3 Manual operation

Manual Processing Operation refers to controlling of the machine tool though keyboard. User can change the operate speed and set the grid under manual processing operation. System will enter Manual Operation state after returned home, and the screen displays:

Manual control state initial interface:





5.3.1 Manual speed switching and adjusting


1) Speed mode switching

There are two speed modes: high speed and low speed. We can change mode by press

". The speed mode you choose will decide the processing speed.

2) Speed adjusting

In manual mode, press—"" to set the current speed mode. If the current speed is low speed, it displays as follow:

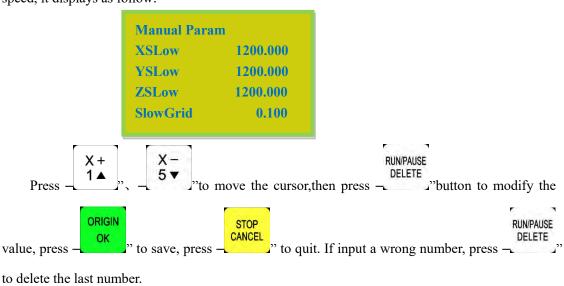

In order to ensure the accuracy of processing and debugging, the system introduces the concept of grid which also called minimum feed. It range is 0.05mm-1.0mm. When user change mode to —tep", machine will move by grid distance.

High speed mode setting is the same as low speed mode.

5.3.2 Manual mode

In order to meet different situation of manual movement, the system provide 3 kind of motion

modes: Continue, step, distance. We can change mode by pressing — "and the bottom of screen will display what the current manual mode is."

1) Continuous motion mode

This mode has no value control. In continuous mode, machine will follow when press the



direction button $\begin{bmatrix} X + \\ 1 \blacktriangle \end{bmatrix}$, $\begin{bmatrix} X - \\ 5 \blacktriangledown \end{bmatrix}$, $\begin{bmatrix} Y + \\ 2 \land \end{bmatrix}$, $\begin{bmatrix} Y - \\ 6 \lor \end{bmatrix}$, $\begin{bmatrix} Z + \\ 3 \end{bmatrix}$, $\begin{bmatrix} Z - \\ 7 \end{bmatrix}$. Its motion speed is decided by current speed mode.

NOTE: If uesers release the button immidiately after pressing the button(shorter than 0.5s), machine will automatically move to the nearest grid point. It always stop on grid point when the motion mode is over. Continuous mode suitable for crude regulation of machine coordinate situation.

2) Step motion mode

This mode is always move in low speed, move 1 grid per 0.5 second. The grid distance is decided by current speed mode. This motion mode is suitable for tool adjusting or precise adjustment of the location of the mechanical coordinates.

3) Distance motion mode

In this mode, it runs according to the setting of distance. Machine will move by the set

distance when user press direction button $\begin{bmatrix} X + \\ 1 \blacktriangle \end{bmatrix}$


 $\begin{bmatrix} X + \\ 1 \blacktriangle \end{bmatrix} \begin{bmatrix} X - \\ 5 \blacktriangledown \end{bmatrix} \begin{bmatrix} Y + \\ 2 \land \end{bmatrix} \begin{bmatrix} Y - \\ 6 \lor \end{bmatrix} \begin{bmatrix} Z + \\ 3 \end{bmatrix}$

Z – 7

NOTE: Grid unable to affect the distance motion mode. Machine will move by set distance, can't move to grid point. If user wants to change distance, please change to distance mode and re-enter the distance value.

5.3.3 Manual testing input and output

In the initial boot interface, that is screen displays as follow:

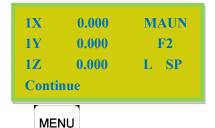


Press — "twice, the screen will displays two rows of arrows which are defaults to all arrows are downwards —".

Upper arrows represent input signal: the former 4 numbers 0, 1, 2, 3 corresponding to X,Y,Z home and tool setting signal. 4,5,6,7 corresponding to driver alarm,hard limit,E-stop and pedal



switch signal.

Manual trigger the corresponding signal switch, if the corresponding arrow flip so, the signal is normal. If not, please check corresponding switches or 50-pin cable and interface board.

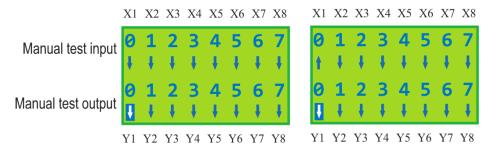

NOTE: Different from Voltage Setup.

Bottom arrrows represent output signal: the former 4 number 0,1,2,3 corresponding to spindle on/off, spindle speed 1-3.4,5 corresponding to alarm indicator, running indicator.

Press — "button can change the arrow direction, so it can control the output of corresponding interface. For example, press — "to flip the arrow upwards under 0, it is equivalent to start the spindle. Press— "again, the arrow flip downwards that is equivalent to stop the spindle.

5.3.4 Manual switching coordinate system

Including machine coordinate system and work coordinate system.


Machine coordinate system is fixed, the origin of coordinates is always a fixed position relative to the machine; Its coordinates is called mechanical values, the origin of coordinates is the origin of the machine or reference point. so that at any time, one point of space can be confirmed by machine coordinate system. Because of reference point is the calculation basis of machine coordinates movement, powered on or remove all abnormal states, you need back to zero.

Work coordinate system used more greatly than other coordinates system in processing. Usually in processing, we describe a processing position is always relative to a certain point on the workpiece, whereas the workpiece on the machine tool's position relative to the mechanical origin is often change, so it is necessary to introduce a set of more convenient coordinate system during processing, this is work coordinate system. The origin of work




coordinate system is a fixed point relative to the workpiece, but relative to the origin of machine coordinate system is floating.

RichAuto-A1X provide a machine coordinate system and nine work coordinates system,

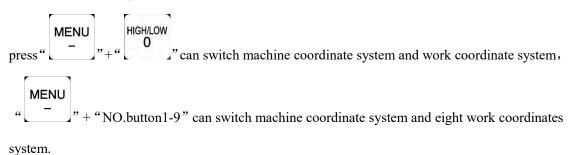

Coordinates system:

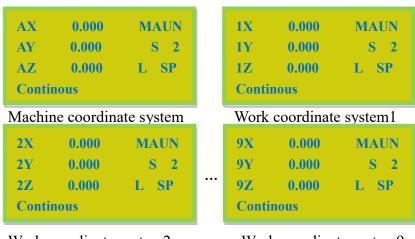

Work coordinate system2 ... Work coordinate system9

NOTE: You can not set work origin under machine coordinate system, switch to work coordinate system to set work origin.

5.4 Automatic processing operation

Auto processing refers to the system runs the file in U disk or inner storage space according to the instruction, it also called file processing. Before auto processing, user must set the machine tool parameters and all of the system parameters correctly.

Auto processing steps as follow:

5.4.1 Set workpiece origin

The origin coordinates of X, Y and Z in the processing program is the origin of the workpiece.

Before operation, we should pay attention to this position as well as the real position. Operation is as




follow:


Move X,Y and Z to the position which will start to process the file on workpiece. Afterwards,

press zero clearing - "can set the origin of X,Y axis. Press zero clearing - "to set the origin of Z axis. It should be noted that if user have already used the tool setting function which combination button is - ", will no need to press the - " button.

5.4.2 Choose processing file

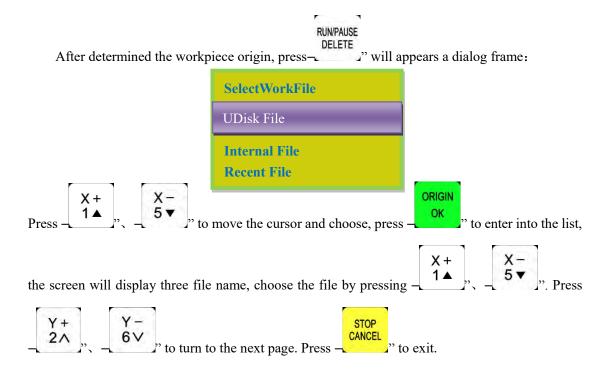

5.4.3 Set processing parameters

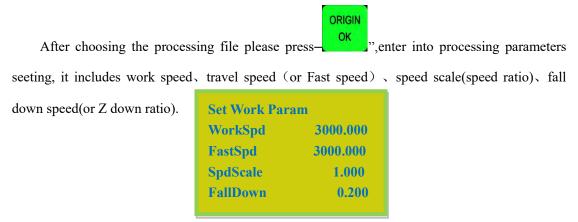



Press – $\begin{bmatrix} X + \\ 1 & \\ \end{bmatrix}$ and – $\begin{bmatrix} X - \\ 5 & \\ \end{bmatrix}$ "to move cursor, press – $\begin{bmatrix} & & \\ & & \\ & & \end{bmatrix}$ " to set the value (next value

setting is the same as this one), then pess—"to save, the system will check the processing code and start to process when checking finished.

The system code checking is auto mode, user can press — "to skip the checking and start ruuning file immidiately."

System will remember the checking only when the previous checking is a complete and correct checking. So that the system will not check the same code again next time.

In the process of processing, the screen scrolling display real-time processing speed, operation

time, current line number. We can switch these options by pressing — ""

5.5 Operations during processing

5.5.1 Speed ratio & spindle grade Adjusting

1) Adjust speed ratio

In process of processing, press $-\frac{Y+}{2}$, $-\frac{Y-}{6}$, can directly change speed ratio, current speed= set speed * ratio, each push on $-\frac{Y+}{2}$, or $-\frac{Y-}{6}$, the speed ratio will go up or dwon drop 0.1. Speed ratio:max 1.0, min 0.1, the displayed speed will corresponding to the changing of speed ratio, but time will not change.

2) Adjust spindle grade

If user has set multistep speed, the DSP handle can change the multistep speed in process of

 
processing. Press
$$\begin{bmatrix} z + \\ 3 \end{bmatrix}$$
, and $\begin{bmatrix} z - \\ 7 \end{bmatrix}$, to change spindle grade.



5.5.2 Pause & adjust position


RUN/PAUSE DELETE

" pause processing. The right upwards of screen will change from—MUN" to -PAUZ' and machine paused processing except the rotating of spindle. Shown below:



At this moment, the user is allowed to adjust the position of X, Y and Z axis. The system default motion mode is STEP. So that user can fine adjust each axis distance. Machine moves one low or high speed grid distance every step. Meanwhile, user can change the speed mode to high

 RUN/PAUSE DELETE " again, screen shows below: When the adjustment is finished, press -



RUN/PAUSE DELETE OK The system asks the user whether save the modified position. Press

ORIGIN

STOP

CANCEL the system will start processing in modified position, press ", system will back to the position before modifying.

5.5.3 Breakpoint processing & power down protection

1) Breakpoint processing

CANCEL " during process of processing, the screen shows below: If user presses





If we want to save breakpoint, press — ", the screen displays break list(totally 8), press

X + 1 ▲ ", 5 ▼ "to choose the save position and then press — " to save, system auto

go to standard interface. If we want to continue processing from the breakpoint, we can choose the

RUNPAUSE DELETE

Combination button — " + — 8" First press — " and not release it at the same

combination button — "" + — 18". First press — " and not release it, at the same time press number button(1-8), then release together, the system will start processing from the breakpoint.

For example: You want to start processing from the breakpoint 1, then you should use the

combination button — " + 4", system will restore processing from breakpoint 1. The screen shows below:

Line NO. 30

If you want to go backwards from this breakpoint, press — "and input the line No.,

RUN/PAUSE

and then press – ", system will work from the new line number.

Input NO: File has 6705 125

2) Power off protection

When there is a sudden power failure during processing, system will save current coordinate and parameters, while power restart, process continue. Before that, system must have a home motion. Shown as below:





Press—"to continue unfinished processing, it will display stop line No, and the line number can be chosen. Press—"cancel the power off protection.

5.6 Advanced Processing

Advanced processing is designed for some special requests, it contains: Array work, Resume work, Tool changing, Part work, Calculate bound, Mill plane, step work file, Calculate work time,

Find break NO. The combination button is — HIGH/LOW 0

Find break NO. The combination button is — "+ — ", shown below:



5.6.1 Array work

Steps as below:

- 1) Press X + 1 = 1, X 1 =
- 2) Press "" to enter file list, then ress 1 ▲ ", 5 ▼ "move the cursor to choose object file.
- 3) Set processing parameters, also can modify the array parameters in this step, or you can go to —AJTO PRO SETUP", choose —Wrk Array" and modify the array parameters. The rest steps are similar to the normal processing. System will start to work according to the user's setting.
- 4) In the processing of array work, you can view current row number, volume number etc. by






CAUTION: Set interval to a negative value if users want a manual control during array processing.

5.6.2 Resume work

Steps as follows:

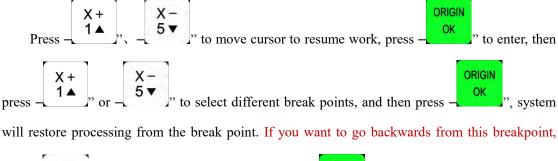


Press — "and input the line No., and then press — ", system will work from the new line number. Specific operation steps in 5.5.3 breakpoint processing & power down protection.


5.6.3 Tool changing

It achieve manually change the tools at the position you set. Press—ORIGIN OK "to enter into the setup, and also press—ORIGIN OK "back to work origin.

5.6.4 Part work

 
Park work means user can select start line and stop line, so part of the processing file can be processed. Steps as follows:




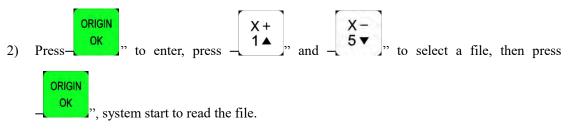



 3) After read the file, press—"the screen display line 1 of the code, press—", prompted—riput start number: displays total lines", input number of start line and press




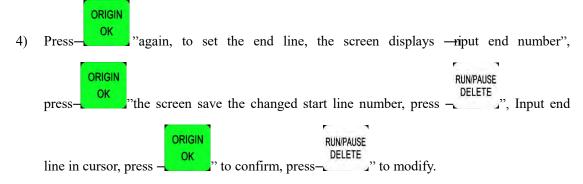


5) Set processing parameters.

5.6.5 Calculate bound

  Calculate bound means user can check the size of processing, So as to avoid unnecessary waste of materials and processing errors. Steps as below:





3) Press — ", system start to read the file, after reading the file, the system will calculate the area.

5.6.6 Mill plane

ORIGIN

Include two types: scan mill and encircle mill.

1. Scan mill





- 1) Press X+
 1 ▲ Y or 5 ▼
 To move cursr to choose the mill type.
- 2) Press "to enter the scan mill set, it includes: Scan type, Width, Height, Diameter, Depth, Z Step, T Ratio.
- 3) Press X → X → Y or move cursor on the option which need modify, press

 RUNPAUSE DELETE

 "to choose mill type(X Scan or Y Scan), also press this button to modify the

 Parameters. Press Runpause or Y Scan), also press this button to modify the

 Parameters. Press Runpause or Y Scan), also press this button to modify the

2. Encircle mill

Scan mill set	
Scan Type	AC
Width	100.000
Height	100.000
Diameter	10.000
Depth	0.100
Z Step	0.100
T Ratio	0.800

- 1) Press $\begin{bmatrix} X + \\ 1 \land \end{bmatrix}$ or $\begin{bmatrix} X \\ 5 \checkmark \end{bmatrix}$ "to move cursr to choose the mill type.
- 2) Press "to enter the scan mill set, it includes: Scan type, Width, Height, Diameter, Depth, Z Step, T Ratio.
- 3) Prss X+
 1 A " and 5 T "to move cursor on the option which need modify, press

 RUNPAUSE
 DELETE
 " to choose mill type(AC or C), also press this button to modify the parameters.

 ORIGIN

" after modified all the parameters to save them.

5.6.7 Calculate work time

ORIGIN

Calculate the processing time according to the system processing speed. After pre-read



processing file, the system will display total processing time. Different processing speed will correspond to different processing time.

5.6.8 Find break no

If fail or forget to save the breakpoint, but not change work origin, after changing new tool,

RUNPAUSE DELETE users can choose this operation. Move X,Y axis to the processing stop position, press " ___ " -

"HIGH/LOW X + X + 1 ▲ X - 5 ▼ "to start -Advanced Work", and then press" x + 1 ▲ ", " x to choose -Find break

no.",press "

ORIGIN
OK

To get in,after reading,screen shows: Press enter key to continue working from searching position,press other key only show the line number.

Press " to start processing, press " DELETE DELETE TO CANCEL ", the screen will show the line number.

CAUTION: Work coordinate system must be same to the coordinate system which saves the breakpoint.

Look for position line number. If accidentally cutter break and user hasn't saved the break point, reboot system and replace the cutter. After that, user can manually move X, Y axis to the

nearest point where the cutter was broken (recommend to move a little further), press—"
enter into — Find break no.", afterwards choose the previous processing file, the system will prompt
—searching current position". System will start processing after finished the searching, the system


will prompt —pass — "start processing, press — "to view the current position of line number".

5.6.9 Scale work

If the actual processing requires different sizes of the same file, you can select the **scale work**, you need to enter an enlargement or reduction ratio for processing.





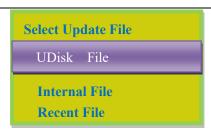

Choose Processing file, input correct parameters:

Sca	de work	param
X	scale	1.000
Y	scale	1.000
Z	scale	1.000

and then press "ORIGIN OK " to start processing.




6. A12--Plasma Cutting Motion Control System

6.1 Handle and buttons introduction

One-touch button and Combination button are same to A11, and the shell color of A12 is brown.



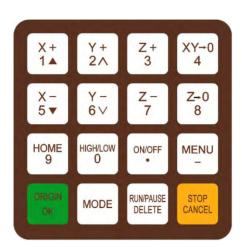

Handle Buttons

	Function
ON/OFF	Arc On/Off, decimal point inputting

The handle and interface board of A12 make special anti-interference, which make system work normally during strong interference.

6.2 Output description

OUTPUT SIGNAL

	Function	Notes
Y01	Plasma are control output	Logic low, control arc&cylinder
Y02	Cylinder Delay output	Up&down delay

6.3 Arc setup&wiring


2-axis setting

- 1) MENU-MACHINE SETUP-Home Setup-Home Order-XY home
- 2) MENU AUTO PRO SETUP Safe Height-Set 0




OUTPUT SIGNAL


2-axis with cylinder delay

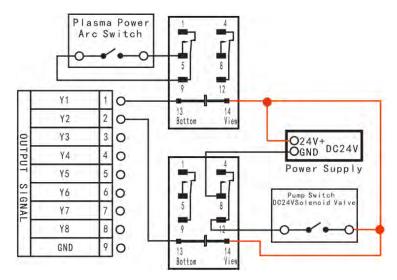

1.2-axis

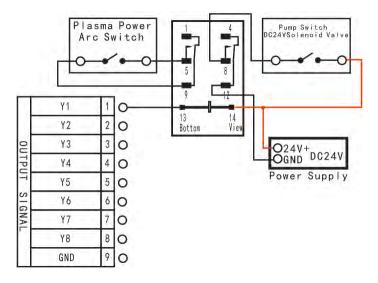

2.3-axis

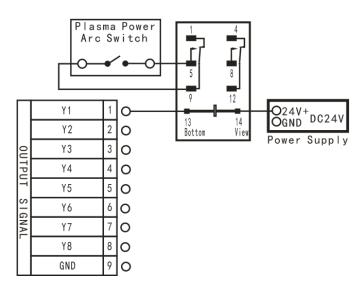



6.4 Parameters description

1. Axis Prohibited (MACHINE SETUP)

If it is a two-axis plasma cutting machine, users can choose to set t Z-axis disable, and all relevant parameters about Z axis will no longer be meaningful.

2. Arc Delay (MACHINE SETUP) Unit: ms

OnDelay: How long to wait for starting plasma after reading file.

OffDelay: How long to wait for closing plasma after processing.

3. Cylinder Delay (MACHINE SETUP) Unit: ms

DwnDelay: How long to wait for cylinder getting down.

UpDelay: How long to wait for cylinder rising up.

4. Circle Limit (AUTO PRO SETUP)

System default 1000 (not speed unit). If small circle processing speed too fast that cause deformation or bad quality, users can reduced this value proportionately, such as 500,250,125 ..., and it can greatly improve the quality of processing.

5. Plasma Config (AUTO PRO SETUP)

PreOnDly: How long to wait for cylinder getting down.

PreOfDly: How long to wait for cylinder rising up.




7. A15--Multi-spindle Motion Control System

7.1 Handle and buttons introduction

The color of A15 handle is brown:



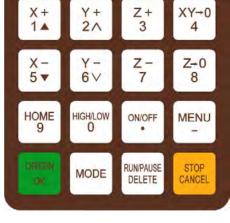

Handle

Buttons

Special combination button

	Combination button	Function
1	ON/OFF " HIGH/LOW O "	Cylinder change over
2	RUN/PAUSE ON/OFF ON/OFF "	Calculate Z axis offset value of each tool

7.2 Output description


OUTPUT SIGNAL

	Function	Notes
Y5	Cylinder 1 output	Logic low, control spindle 1 up and down
Y6	Cylinder 2 output	Logic low, control spindle 2 up and down
Y7	Cylinder 3 output	Logic low, control spindle 3 up and down
Y8	Cylinder 4 output	Logic low, control spindle 4 up and down




7.3 Spindle wiring

1. Count 1(Spindle On/Off): One spindle with one inverter, spindle 3,4 same as 1,2.

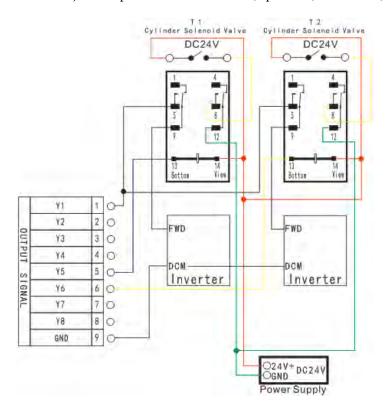


2. Count 3, multi-speed: One spindle with one inverter, spindle 3,4 same as 1,2.

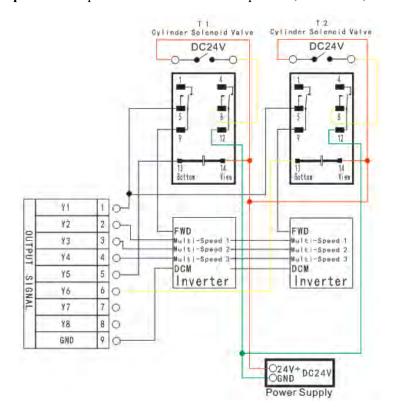



3. Two spindles with one inverter

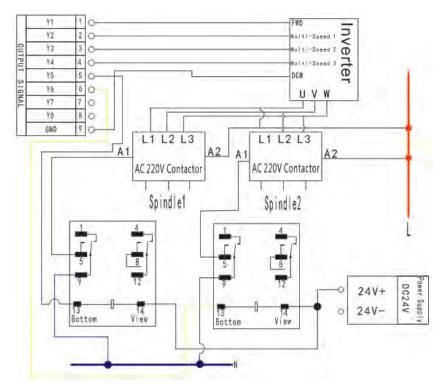

7.4 Multi-spindle setup

1.Tool Setup: (MACHINE SETUP)

Tool Count: Input spindle count, Max 4.

Offset:

a) Offsets of X,Y:

1) Input by measuring.

 
now users can see the coordinate values of X,Y axis on the screen,the values are the offsets of




spindle 2(note that positive or negative).


Same to spindle 3,4.

Steps: Press "Tool Setup", Screen displays "Press OK key to set tool offset by manual mode, it's very simple but not accurate, press cancel to set by mumber.", and then



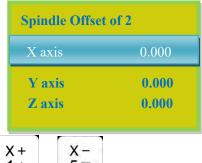

 Press — "/— " to move cursor to where users want to modify, and then press




After setting spindle 2,press "CANCEL", the screen will show the interface of —SpindleOffset of 3",same to spindle 4.

b) Offset of Z:

1) The machine is not equipped with C.A.D(Tool sensor)

Firstly, get in —SYSTEM SETUP-Function Confi-ToolSet", choose Maunal.

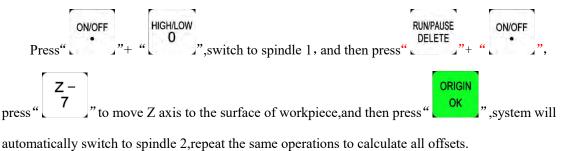


After calculating all offsets, choose anyone of the spindles to set work origin, also press



2) The machine is equipped with C.A.D(Tool sensor)

 Firstly, get in -SYSTEM SETUP-Function Confi-ToolSet", choose Atuo.



system will automatically move Z axis to the surface of C.A.D(Tool sensor), after touching the surface, system will automatically switch to spindle 2, repeat the same operations to calculate all offsets.

After calculating all offsets, choose anyone of the spindles to set work origin, also press

2. Cylinder Delay: Unit: ms (MACHINE SETUP)

Time of waiting cylinder rising or falling finished.

7.5 G code example

T1 (Switch to spindle 1)	T2 (Switch to spindle 2)
M03 (Spindle 1 CW)	M03 (Spindle 2 CW)
G00 X20 Y20 Z0	G00 X2 Y2 Z0
G01 X20 Y20 Z-2	G01 X2 Y2 Z-2
G01 X120 Y20 Z-2	G01 X12 Y2 Z-2
G01 X120 Y120 Z-2	G01 X12 Y12 Z-2
G01 X20 Y120 Z-2	G01 X2 Y12 Z-2
G01 X20 Y20 Z-2	G01 X2 Y2 Z-2
G00 Z20	G00 Z20
G00 X20 Y20	G00 X2 Y2
M05 (Spindle 1 Off)	M05 (Spindle 2 Off)

T3,T4 same as T1,T2, the last line of the program can choose to write M30-- end of program,and return to program top



8. A18--Four-axis Linkage Motion Control System

8.1 Handle buttons introduction

	Combination button	Function
X+ Y+ Z+ XY-0 1 A 2 A 3 X+ XY-0	ON/OFF C+ XY→0	Set X axis and Y axis work
X- 5▼	" + " X 4 0]"	origin
HOME HIGHLOW ONOFF MENU	ON/OFF C-ZC→0	Set Z axis and A axis work
DRIGIN MODE RUNPAUSE STOP CANCEL	" + " 8 "	origin
C+ XY+0 C- ZC+0	Positive movement o	f A axis, figure 4 inputting
4 , 8	Negative movement of A axis, figure 8 inputting	
MENU	Enter menu setting, negative sign inputting,cl	
_	during processing	

8.2 Input description

Port	Port	Signal description	Pin functions	Notes
lable	definition		and parameters	
	X01	X Machine zero	Logic low	For external connection with mechanical, photoelectrical or proximity switch
	X02	Y Machine zero	Logic low	For external connection with mechanical, photoelectrical or proximity switch
INPUT	X03	Z Machine zero	Logic low	For external connection with mechanical, photoelectrical or proximity switch
NPUT SIGNAL	X04	A Machine zero	Logic low	For external connection with mechanical, photoelectrical or proximity switch
	X05	Tool setting	Logic low	
	X06	Driver alarm	Logic low	
	X07	Hard limit	Logic low	
	X08	E-stop	Logic low	



8.3 Parameters description

1.Pulse equiv: Unit: ms (MACHINE SETUP)

Rotation axis stepper driver: Formula = pulses per revolution / angles per revolution (360°)



$$pulse = \frac{\frac{360^{\circ}}{\text{stepper angle}} * driver subdivision}{360^{\circ} * transmission ratio}$$

Rotation axis servo driver: Handle pulse equivalent(400)*360* mechanical transmission ratio

2.Work Orig Offset: (Auto Pro Setup, Unit: mm)

It is mainly used for the work origin position which is the center of the processing material. If the processing material is cylindrical and work origin is the center, we can still set origin on the surface and then modify work origin offset number for cylindrical radius, so that the actual work origin is the center. X, Y, A are the same.

3.The rotation axis labels: (System Setup - Function Configuration-Rotatamark)

Change the rotation axis marked with A, B, C three markup, the user changes the actual situation, the changes and the need to reboot the system off.

8.4 G code example

G90 G54

M03

G01 X209.5 Y5.684 Z90. A0.0 F3000

X4. Y5.51 Z89.851 A4.708

Y.02 Z23.188

M05

M30




9. Appendix

9.1 System upgrade

Copy upgrade file to U disk, and insert U disk into handle, file format: extension ******.

PKG & shown as rz-xxxx.

U Disk Upgrade Method 1

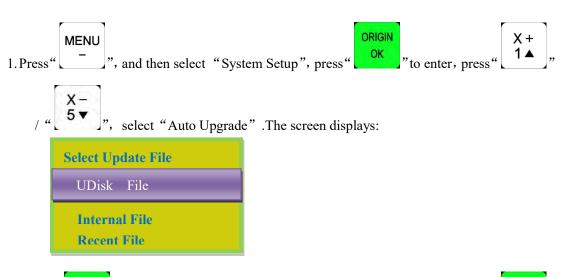

- ORIGIN OK "to enter, select "Udisk File", then select upgrade file, press "


 System will auto upgrade.

 ORIGIN OK "

 system will auto upgrade.
- 3. After upgrade completed, restart the handle.

U Disk Upgrade Method 2

1. Copy upgrade file to U disk, and insert U disk into handle.

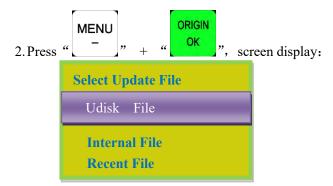

3. Repeat Method 2 operation 1.2&1.3.



9.2 U-disk Function

Users can copy file from computer to handle after "Product ID:A010XXXX & Update Version rz-1967" version. Connect handle and computer by USB cable, users can find portable storage device on the computer, and then copy processing files from computer to handle inner. This function can insure that if USB port of the handle is broken or there is no U disk, the machine can still work normally.

 
Steps:

- 4. Press any two buttons at the same time (for example: "ORIGIN OK" + "MODE ")
- 5. Connect handle and computer by USB cable, it means that the handle is powered by computer, loosen the buttons after the power supply.
- 6. Handle screen displays:



Connect successfully.

7. Open "My Computer", and you will find portable storage device:



A0101203(H:): Handle, Users can copy processing files to handle inner.


8. Connect handle and machine, Choose internal file to start processing.

NOTE: Users can check hardware type in Version View: "FlashDiskMode" is necessary or not ,if not, users can not copy processing files from computer to handle inner.


9.3 Servo driver parameters

9.3.1 YASKAWA Σ -7, Σ -V

1. Wiring diagram (Y, Z same as X) Set PnA=8170,do not connect pin-40

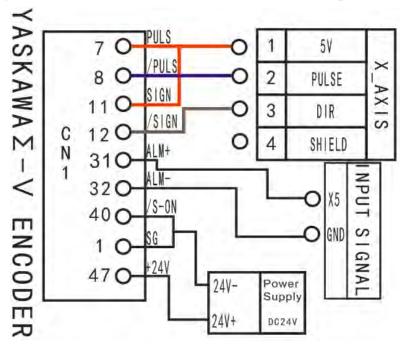

Motor brake:

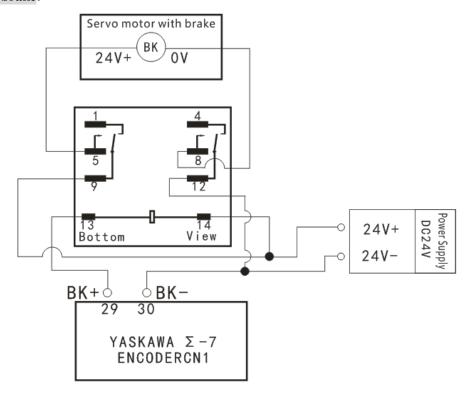

 Σ -7 same as Σ - V

2. Parameter setting

Para. No.	Function	Value	Description
*Pn000	Function	0010	Bit 0: Set 0,positive rotation at positive rotation
	selection basic		command
	switch 0		Bit 1: Set 1,position control mode(pulse sequence
			command)
*Pn200	Format seletion	0005	Bit 0: Set 5, select the instruction mode as
	switch of		-p ulse+direction",negative logic
	position control		
47.00	command	27. 1	
*Pn20E	Electronic gear	Need	Pn20E=Encoder resolution
	ratio(numerator)	calculation	Pn210=Pulse equivalent×Screw pitch×Transmission
			•
*D 210	T1 .	3.7 1	ratio
*Pn210	Electronic gear ratio(denominato	Need calculation	e.g. Pulse equivalent 1000, Screw pitch 10mm,
	r)	calculation	Encoder 20-bit, Transmission ratio 1
	1)		$Pn20E/Pn210 = 2^{20}/1000 \times 10 \times 1 = 1048576/10000$
			=131072/625
*Pn50A	Input signal	8170	Bit 1: Set 7,servo on all the time.
	selection 1		Bit 3: Set 8,positive rotation not used and signal
			input(P-OT)prohibited
*Pn50F	Output signal	0300	Set it when servo motor with brakes.
	selection 2		Bit 2: Set 3,brake interlock signal -BK"is output
			from CN1-29,CN1-30 to control 24V relay used for
			brake
*Pn50E	Output signal	0211	Set it when servo motor with brakes.
	selection 1		To avoid of CN1-29 and CN1-30 being used for
			other function and leading to brake ineffective,3 is
			not allowed to appear in the 4 digits.

NOTES:

1.

... Bit2 Bit1 Bit0 ... 0 0 0

The same below.


- 2. For parameters which No. have a suffix of "*", changed contents will be validated when you turn on the control power. **The same below.**
- 3. ALM+: pin-31, ALM-: pin-32, normally closed. The default alarm input terminal of A11,A12,A15 is X5,A18 is X6.

Machine Setup-Voltage Setup, modify level of X5(X6-A18) normally closed(Press "RUNPAUSE DELETE" "



chang he direction of the arrow facing up) The same below.

X1 X2 X3 X4 X5 X6 X7 X8

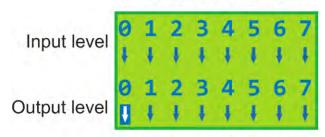


Y1 Y2 Y3 Y4 Y5 Y6 Y7 Y8


↓ :normally open, ↑ :normally colsed

9.3.2 PANASONIC MINAS A5

1. Wiring diagram (Y, Z same as X) Set Pr4.05=8618883,do not connect pin-29

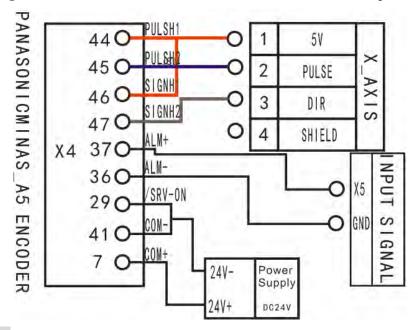

Motor brake:

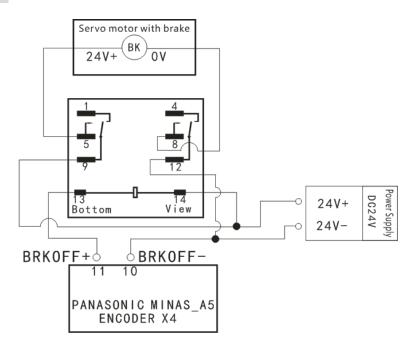



2. Parameter setting

Para.	Function	Value	Description
No.			•
*Pr0.00	Setting the direction	0	If the motor rotation direction opposite to the
	of rotation		actual needs, set 1.
*Pr0.01	Select control mode	0	0:Position mode,1: velocity mode,2: torque mode
*Pr0.05	Selection of command pulse input	0	0:Photo-coupler input (PULS1,PULS2,SIGN1,SIGN2) 1:Exclusive input for line driver (PULSH1,PULSH2,SIGNH1,SIGNH2)
*Pr0.07	Command pulse input	3	Set command pulse input mode:command
	mode setup		pulse+command direction,negative ligic.
*Pr0.08	Command pulse No.	0	When it is set to -0", parameters Pr0.09 and
	per motor circle		Pr0.10 are valid
Pr0.09	1st numerator of command pulse frequency multiplication	Need calculatio n Range:0~ 2 ³⁰	Z1 = Encoder resolution Z2 = Pulse equivalent×Screw pitch×Transmission ratio e.g. Pulse equivalent 1000, Screw pitch 10mm, Encoder resolution 10000, Transmission ratio 1
	D : 0.1		Z1/Z2= 10000/1000×10×1=1/1
Pr0.10	Denominator of the command pulse frequency multiplication	Need calculatio n Range:0~ 2 ³⁰	set Pr0.09=1,set Pr0.10=1. The value of Pr0.09 and Pr0.10 must be integer,range: 0~230 .
*Pr4.05	Function setting for digital input pin SI6	8618883	Bit1,0 :Set 83,servo on all the time.


NOTES:

1. ALM+: pin-37, ALM-: pin-36, normally closed.




9.3.3 DELTA ASDA-A2&B2

1. Wiring diagram (Y, Z same as X) Set P2-10=1, do not connect pin-9

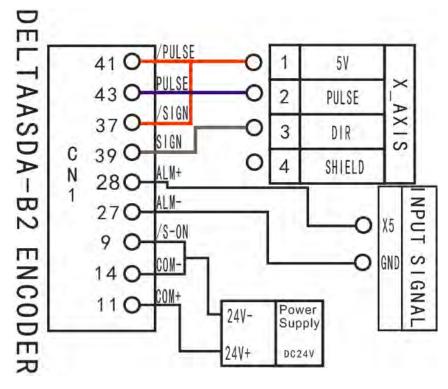

A2 Series PULSE,/PULSE,SIGN,/SIGN correspond pin-43,41,36,37, COM- corresponds pin-45/47/49

Motor brake:

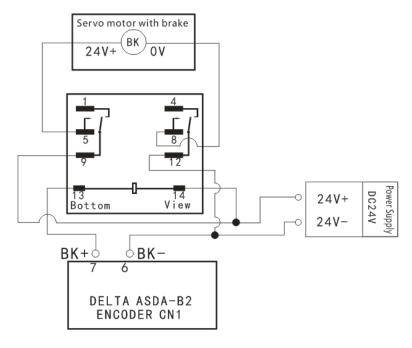

A2 series BK-,BK+ correspond CN1-1,26



2.Parameter setting

DELTA	Function	Value	Description
ASDA-B2 P1-00	External pulse train input type	102	Bit 0: 2pulse+direction Bit 2: 1negative logic
*P1-01	Set control mode	0000	Bit 3: Maintaining the set value. Since switching control mode is not used, bit 30. Bit 2: 0forward rotation (CCW) (from the view of load) Bit 1,0: 00position control mode
P1-44	Electronic gear ratio(numerator)(Z1)	Need calculation	Range: 1~32767; Z1 =Encoder pulses×4; Z2 =Pulse equivalent×Screw pitch×Transmission
P1-45	Electronic gear ratio(denominator) (Z2)	Need calculation	ratio e.g. Pulse equivalent 1000, Screw pitch 10mm, encoder pulses 40000, Transmission ratio 1 Pn1-44/Pn1-45=40000×4/1000×10×1=160000/10000 =16/1
P2-10	Function setting for digital input pin DI1	1	Bit 0: Set 1,servo on all the time.
P2-18	Function setting for digital output pin DO1	108	DO1 corresponds to pin-6 & pin-7,used as clamping-position brake signal of Z-axis Bit1,0: 08set pin-6 and pin-7 as BK- and BK+ repectively.
			Bit2: 0set DO15 output as normally closed b-contact point
P2-22	Function setting for digital output pin DO5	007	DO5 corresponds to pin-28 & pin-27,used as servo alarm signal Bit1,0: 07set pin-28 and pin-27 as ALRM+ and ALRM- repectively. Bit2: 0set DO5 output as normally closed b-contact point



DELTA	Function Function	Value	Description
ASDA-A2			
P1-00	External pulse	102	Bit 0: 2pulse+direction
	train input type		Bit 2: 1negative logic Bit 3: Maintaining the set value. Since switching
*P1-01	Set control	0000	control mode is not used,bit 30.
	mode		Bit 2: 0forward rotation(CCW)(from the view of
			load)
			Bit 1,0: 00position control mode
	Electronic gear	Need	Range: 1~32767;
P1-44	ratio(numerator)(Z1)	calculatio n	Z1 =Encoder pulses×4;
			Z2 =Pulse equivalent×Screw pitch×Transmission
P1-45	Electronic gear ratio(denominat	Need calculatio	ratio
F1-43	or) (Z2)	n	e.g. Pulse equivalent 1000, Screw pitch 10mm,
			encoder pulses 40000, Transmission ratio 1
			Pn1-44/Pn1-45=40000×4/1000×10×1=160000/100 00
			=16/1
	Function setting for digital input	1	Bit 0: Set 1,servo on all the time.
P2-10	pin DI1		
	Function setting		DO1 corresponds to pin-6 & pin-7,used as
P2-21	for digital	108	clamping-position brake signal of Z-axis
	output pin DO1		Bit1,0: 08set pin-6 and pin-7 as BK- and BK+
			repectively.
			Bit2: 0set DO15 output as normally closed
			b-contact point
			DO5 corresponds to pin-28 & pin-27,used as servo
P2-22	Function setting	007	alarm signal
	for digital		Bit1,0: 07set pin-28 and pin-27 as ALRM+ and
	output pin DO5		ALRM- repectively.
			Bit2: 0set DO5 output as normally closed
			b-contact point



9.4 G code list

G code list of A1X &A5X			
G00	Rapid positioning		
G01	Linear interpolation		
G02	Circular interpolation CW		
G03	Circular interpolation CW Circular interpolation CCW		
G04	Dwell (Unit: millisecond)		
G17	Selection of XY coordinate plane		
G17	*		
G18	Selection of ZX coordinate plane		
G20	Selection of YZ coordinate plane		
G20 G21	Input in inch		
	Input in metric		
G28	Auto back to reference point		
G30	Back to secondary reference point		
G40	Cancel tool radius compensation		
G41	Left tool compensation(the tool offsets radius distance on the left side of tool		
C 42	moving direction)		
G42	Right tool compensation(the tool offsets radius distance on the right side of tool		
G 42	moving direction)		
G43	Tool length compensation (compensation along positive direction)		
G44	Tool length compensation (compensation along negative direction)		
G49	Cancel tool length compensation		
G54	Work coordinate system 1		
G55	Work coordinate system 2		
G56	Work coordinate system 3		
G57	Work coordinate system 4		
G58	Work coordinate system 5		
G59	Work coordinate system 6		
G73	High-speed peck drilling cycle for deep holes		
G80	Canned cycle cancel		
G81	Drilling cycle		
G82	Drilling cycle of dwell at bottom of hole		
G83	Peck drilling cycle for deep holes		
G84	Righthand tapping cycle		
G90	Absolute programming		
G91	Incremental programming		
G98	Return to initial point		
G99	Return to point R		
G101	Move with processing speed until the signal is triggered.Meanwhile Rollback		
	and pinpoint signal edge (similar to backing home)		
G102	Move with fast speed until the signal is triggered. Meanwhile Rollback and		




G103 Move with processing speed until the signal is triggered. G104 Move with fast speed until the signal is triggered. M03 Spindle on(CW rotation) M04 Spindle on(CW rotation) M05 Spindle stop M06 Tool change M08 Coolant on (Flood) M09 Coolant off M30 End of program, and return to program top M37 Spindle on(CW rotation) M38 Spindle on(CW rotation) M39 Spindle on(CW rotation) M30 End of program, and return to program top M37 Spindle on(CW rotation) M38 Spindle on(CW rotation) M19 4th spindle on M208 Cycle machining M210 Set output logic low level M211 Set output logic low level M214 Run the next line of G code after waiting for the specified input signal logic high M215 Run the next line of G code after waiting for the specified input signal logic high M216 Run the next line of G code after waiting until all the specified input signal logic high M217 Run the next line of G code after waiting until anyone of all the specified input signal logic high M220 Set Y1 logic low level M221 Set Y1 logic low level M222 Set Y2 logic high level M223 Set Y2 logic high level M224 Set Y3 logic high level M225 Set Y4 logic high level M226 Set Y4 logic high level M277 Set Y4 logic high level M278 Set Y4 logic high level M350 Set the extension output logic low level M351 Set the extension output logic high level T Tool function S Spindle speed F Feedrate H Tool length offset	/ WIZHITI	pinpoint signal edge (similar to backing home)		
G104 Move with fast speed until the signal is triggered. M03 Spindle on(CW rotation) M04 Spindle stop M06 Tool change M08 Coolant on (Flood) M09 Coolant off M30 End of program, and return to program top M37 Spindle on(CW rotation) M38 Spindle on(CCW rotation) M129 4th spindle on M210 Set output logic low level M211 Set output logic high level M214 Run the next line of G code after waiting for the specified input signal logic high M215 Run the next line of G code after waiting until all the specified input signal logic high M216 Run the next line of G code after waiting until all the specified input signal logic high M217 Run the next line of G code after waiting until anyone of all the specified input signal logic high level M220 Set Y1 logic low level M221 Set Y1 logic high level M222 Set Y2 logic low level M223 Set Y2 logic high level M224 Set Y3 logic high level M225 Set Y4 log	G103			
M03 Spindle on(CW rotation) M04 Spindle on(CCW rotation) M05 Spindle stop M06 Tool change M08 Coolant on (Flood) M09 Coolant off M30 End of program, and return to program top M37 Spindle on(CW rotation) M38 Spindle on(CCW rotation) M129 4th spindle on M208 Cycle machining M210 Set output logic low level M211 Set output logic high level M214 Run the next line of G code after waiting for the specified input signal logic low ligh M215 Run the next line of G code after waiting until all the specified input signal logic high M216 Run the next line of G code after waiting until anyone of all the specified input signal logic high M221 Set Y1 logic low level M222 Set Y2 logic low level M223 Set Y2 logic low level M224 Set Y3 logic low level M225 Set Y3 logic high level M226 Set Y4 logic high level M227 Set Y4 logic low level </td <td></td> <td colspan="3"></td>				
M04 Spindle on(CCW rotation) M05 Spindle stop M06 Tool change M08 Coolant on (Flood) M09 Coolant off M30 End of program, and return to program top M37 Spindle on(CW rotation) M38 Spindle on(CCW rotation) M129 4th spindle on M208 Cycle machining M210 Set output logic low level M211 Set output logic low level M214 Run the next line of G code after waiting for the specified input signal logic low M215 Run the next line of G code after waiting until all the specified input signal logic high M217 Run the next line of G code after waiting until anyone of all the specified input signal logic high M220 Set Y1 logic low level M221 Set Y2 logic high level M222 Set Y2 logic low level M223 Set Y2 logic low level M224 Set Y3 logic high level M225 Set Y4 logic low level M226 Set Y4 logic low level M227 Set Y4 logic high level				
M05 Spindle stop M06 Tool change M08 Coolant on (Flood) M09 Coolant off M30 End of program, and return to program top M37 Spindle on(CW rotation) M38 Spindle on(CCW rotation) M129 4th spindle on M208 Cycle machining M210 Set output logic low level M211 Set output logic high level M214 Run the next line of G code after waiting for the specified input signal logic low ligh M215 Run the next line of G code after waiting until all the specified input signal logic high M216 Run the next line of G code after waiting until anyone of all the specified input signal logic high M221 Run the next line of G code after waiting until anyone of all the specified input signal logic high M221 Set Y1 logic low level M222 Set Y2 logic low level M223 Set Y2 logic low level M224 Set Y3 logic high level M225 Set Y4 logic low level M226 Set Y4 logic low level M227 Set Y4 logic high level M280 Set the extension output logic low level				
M06 Tool change M08 Coolant on (Flood) M09 Coolant off M30 End of program, and return to program top M37 Spindle on(CW rotation) M38 Spindle on(CCW rotation) M129 4th spindle on M208 Cycle machining M210 Set output logic low level M211 Set output logic high level M214 Run the next line of G code after waiting for the specified input signal logic low M215 Run the next line of G code after waiting until all the specified input signal logic high M216 Run the next line of G code after waiting until anyone of all the specified input signal logic high M221 Set Y1 logic low level M222 Set Y2 logic low level M221 Set Y1 logic high level M222 Set Y2 logic low level M223 Set Y2 logic high level M224 Set Y3 logic high level M225 Set Y3 logic high level M226 Set Y4 logic low level M227 Set Y4 logic high level M350 Set the extension output logic low level M351 Set the exten				
M08 Coolant off (Flood) M09 Coolant off M30 End of program, and return to program top M37 Spindle on(CW rotation) M38 Spindle on(CCW rotation) M129 4th spindle on M208 Cycle machining M210 Set output logic low level M211 Set output logic high level M214 Run the next line of G code after waiting for the specified input signal logic low M215 Run the next line of G code after waiting until all the specified input signal logic high M216 Run the next line of G code after waiting until anyone of all the specified input signal logic high M227 Set Y1 logic low level M220 Set Y2 logic low level M221 Set Y2 logic low level M222 Set Y2 logic high level M223 Set Y2 logic low level M224 Set Y3 logic low level M225 Set Y3 logic low level M226 Set Y4 logic high level M27 Set Y4 logic low level M28 Set the extension output logic low level M350				
M09Coolant offM30End of program, and return to program topM37Spindle on(CW rotation)M38Spindle on(CCW rotation)M1294th spindle onM208Cycle machiningM210Set output logic low levelM211Set output logic high levelM214Run the next line of G code after waiting for the specified input signal logic lowM215Run the next line of G code after waiting for the specified input signal logic highM216Run the next line of G code after waiting until all the specified input signal logic highM221Run the next line of G code after waiting until anyone of all the specified input signal logic highM220Set Y1 logic low levelM221Set Y2 logic low levelM222Set Y2 logic low levelM223Set Y2 logic high levelM224Set Y3 logic low levelM225Set Y3 logic high levelM226Set Y4 logic low levelM227Set Y4 logic high levelM230Set the extension output logic low levelM351Set the extension output logic high levelTool functionSpindle speedFFeedrate				
M30 End of program, and return to program top M37 Spindle on(CW rotation) M38 Spindle on(CCW rotation) M129 4th spindle on M208 Cycle machining M210 Set output logic low level M211 Set output logic high level M214 Run the next line of G code after waiting for the specified input signal logic low M215 Run the next line of G code after waiting until all the specified input signal logic high M216 Run the next line of G code after waiting until anyone of all the specified input signal logic high M221 Run the next line of G code after waiting until anyone of all the specified input signal logic high M220 Set Y1 logic low level M221 Set Y2 logic low level M222 Set Y2 logic low level M223 Set Y2 logic high level M224 Set Y3 logic low level M225 Set Y3 logic high level M226 Set Y4 logic low level M227 Set Y4 logic high level M350 Set the extension output logic low level M351 Set the extension output logic high level T Tool function <th< td=""><td></td><td colspan="3"></td></th<>				
M37Spindle on(CW rotation)M38Spindle on(CCW rotation)M1294th spindle onM208Cycle machiningM210Set output logic low levelM211Set output logic high levelM214Run the next line of G code after waiting for the specified input signal logic lowM215Run the next line of G code after waiting for the specified input signal logic highM216Run the next line of G code after waiting until all the specified input signal logic highM217Run the next line of G code after waiting until anyone of all the specified input signal logic highM220Set Y1 logic low levelM221Set Y1 logic high levelM222Set Y2 logic low levelM223Set Y2 logic high levelM224Set Y3 logic high levelM225Set Y3 logic high levelM226Set Y4 logic low levelM227Set Y4 logic high levelM350Set the extension output logic low levelM351Set the extension output logic high levelTTool functionSSpindle speedFFeedrate				
M38 Spindle on(CCW rotation) M129 4th spindle on M208 Cycle machining M210 Set output logic low level M211 Set output logic high level M214 Run the next line of G code after waiting for the specified input signal logic low M215 Run the next line of G code after waiting for the specified input signal logic high M216 Run the next line of G code after waiting until all the specified input signal logic high M217 Run the next line of G code after waiting until anyone of all the specified input signal logic high M220 Set Y1 logic low level M221 Set Y1 logic low level M222 Set Y2 logic low level M223 Set Y2 logic high level M224 Set Y3 logic high level M225 Set Y3 logic high level M226 Set Y4 logic high level M227 Set Y4 logic high level M350 Set the extension output logic low level M351 Set the extension output logic high level T Tool function S Spindle speed F Feedrate				
M1294th spindle onM208Cycle machiningM210Set output logic low levelM211Set output logic high levelM214Run the next line of G code after waiting for the specified input signal logic lowM215Run the next line of G code after waiting for the specified input signal logic highM216Run the next line of G code after waiting until all the specified input signal logic highM227Run the next line of G code after waiting until anyone of all the specified input signal logic highM220Set Y1 logic low levelM221Set Y1 logic high levelM222Set Y2 logic high levelM223Set Y2 logic low levelM24Set Y3 logic high levelM25Set Y4 logic low levelM26Set Y4 logic high levelM27Set Y4 logic high levelM350Set the extension output logic low levelM351Set the extension output logic high levelTTool functionSSpindle speedFFeedrate	M37			
M208Cycle machiningM210Set output logic low levelM211Set output logic high levelM214Run the next line of G code after waiting for the specified input signal logic lowM215Run the next line of G code after waiting for the specified input signal logic highM216Run the next line of G code after waiting until all the specified input signal logic highM217Run the next line of G code after waiting until anyone of all the specified input signal logic highM220Set Y1 logic low levelM221Set Y2 logic low levelM222Set Y2 logic low levelM223Set Y2 logic low levelM24Set Y3 logic low levelM25Set Y3 logic low levelM26Set Y4 logic low levelM27Set Y4 logic high levelM28Set Y4 logic high levelM350Set the extension output logic low levelM351Set the extension output logic high levelTTool functionSSpindle speedFFeedrate	M38	Spindle on(CCW rotation)		
M210Set output logic low levelM211Set output logic high levelM214Run the next line of G code after waiting for the specified input signal logic lowM215Run the next line of G code after waiting for the specified input signal logic highM216Run the next line of G code after waiting until all the specified input signal logic highM217Run the next line of G code after waiting until anyone of all the specified input signal logic highM220Set Y1 logic low levelM221Set Y1 logic high levelM222Set Y2 logic low levelM223Set Y2 logic low levelM224Set Y3 logic low levelM225Set Y3 logic low levelM226Set Y4 logic low levelM227Set Y4 logic low levelM350Set the extension output logic low levelM351Set the extension output logic high levelTTool functionSSpindle speedFFeedrate	M129	4th spindle on		
M211Set output logic high levelM214Run the next line of G code after waiting for the specified input signal logic lowM215Run the next line of G code after waiting for the specified input signal logic highM216Run the next line of G code after waiting until all the specified input signal logic highM217Run the next line of G code after waiting until anyone of all the specified input signal logic highM220Set Y1 logic low levelM221Set Y2 logic low levelM222Set Y2 logic low levelM223Set Y2 logic high levelM224Set Y3 logic low levelM225Set Y3 logic high levelM226Set Y4 logic low levelM27Set Y4 logic high levelM350Set the extension output logic low levelM351Set the extension output logic high levelTTool functionSSpindle speedFFeedrate	M208	Cycle machining		
M214Run the next line of G code after waiting for the specified input signal logic lowM215Run the next line of G code after waiting for the specified input signal logic highM216Run the next line of G code after waiting until all the specified input signal logic highM217Run the next line of G code after waiting until anyone of all the specified input signal logic highM220Set Y1 logic low levelM221Set Y1 logic high levelM222Set Y2 logic low levelM223Set Y2 logic low levelM224Set Y3 logic low levelM225Set Y3 logic high levelM226Set Y4 logic low levelM227Set Y4 logic high levelM350Set the extension output logic low levelM351Set the extension output logic high levelTTool functionSSpindle speedFFeedrate	M210	Set output logic low level		
M215Run the next line of G code after waiting for the specified input signal logic highM216Run the next line of G code after waiting until all the specified input signal logic highM217Run the next line of G code after waiting until anyone of all the specified input signal logic highM220Set Y1 logic low levelM221Set Y1 logic high levelM222Set Y2 logic low levelM223Set Y2 logic high levelM224Set Y3 logic high levelM225Set Y3 logic high levelM226Set Y4 logic low levelM27Set Y4 logic high levelM350Set the extension output logic low levelM351Set the extension output logic high levelTTool functionSSpindle speedFFeedrate	M211	Set output logic high level		
high Run the next line of G code after waiting until all the specified input signal logic high Run the next line of G code after waiting until anyone of all the specified input signal logic high M220 Set Y1 logic low level M221 Set Y1 logic high level M222 Set Y2 logic low level M223 Set Y2 logic low level M224 Set Y3 logic high level M225 Set Y3 logic low level M226 Set Y4 logic low level M27 Set Y4 logic high level M350 Set the extension output logic low level M351 Set the extension output logic high level T Tool function S Spindle speed F Feedrate	M214	Run the next line of G code after waiting for the specified input signal logic low		
Run the next line of G code after waiting until all the specified input signal logic high Run the next line of G code after waiting until anyone of all the specified input signal logic high M220 Set Y1 logic low level M221 Set Y1 logic high level M222 Set Y2 logic low level M223 Set Y2 logic high level M224 Set Y3 logic low level M225 Set Y3 logic high level M226 Set Y4 logic high level M27 Set Y4 logic high level M350 Set the extension output logic low level M351 Set the extension output logic high level T Tool function S Spindle speed F Feedrate	M215	Run the next line of G code after waiting for the specified input signal logic		
high M217 Run the next line of G code after waiting until anyone of all the specified input signal logic high M220 Set Y1 logic low level M221 Set Y2 logic high level M222 Set Y2 logic low level M223 Set Y2 logic high level M224 Set Y3 logic high level M225 Set Y3 logic low level M226 Set Y4 logic low level M27 Set Y4 logic high level M27 Set Y4 logic high level M350 Set the extension output logic low level M351 Set the extension output logic high level T Tool function S Spindle speed F Feedrate		high		
M217 Run the next line of G code after waiting until anyone of all the specified input signal logic high M220 Set Y1 logic low level M221 Set Y2 logic high level M222 Set Y2 logic high level M223 Set Y2 logic high level M224 Set Y3 logic low level M225 Set Y3 logic low level M226 Set Y4 logic low level M27 Set Y4 logic high level M350 Set the extension output logic low level M351 Set the extension output logic high level T Tool function S Spindle speed F Feedrate	M216	Run the next line of G code after waiting until all the specified input signal logic		
signal logic high M220 Set Y1 logic low level M221 Set Y1 logic high level M222 Set Y2 logic low level M223 Set Y2 logic high level M224 Set Y3 logic low level M225 Set Y3 logic high level M226 Set Y4 logic low level M27 Set Y4 logic low level M350 Set the extension output logic low level T Tool function S Spindle speed F Feedrate		high		
M220Set Y1 logic low levelM221Set Y1 logic high levelM222Set Y2 logic low levelM223Set Y2 logic high levelM224Set Y3 logic low levelM225Set Y3 logic high levelM226Set Y4 logic low levelM227Set Y4 logic high levelM350Set the extension output logic low levelM351Set the extension output logic high levelTTool functionSSpindle speedFFeedrate	M217	Run the next line of G code after waiting until anyone of all the specified input		
M221 Set Y1 logic high level M222 Set Y2 logic low level M223 Set Y2 logic high level M224 Set Y3 logic low level M225 Set Y3 logic high level M226 Set Y4 logic low level M227 Set Y4 logic high level M350 Set the extension output logic low level M351 Set the extension output logic high level T Tool function S Spindle speed F Feedrate		signal logic high		
M222Set Y2 logic low levelM223Set Y2 logic high levelM224Set Y3 logic low levelM225Set Y3 logic high levelM226Set Y4 logic low levelM227Set Y4 logic high levelM350Set the extension output logic low levelM351Set the extension output logic high levelTTool functionSSpindle speedFFeedrate	M220	Set Y1 logic low level		
M223Set Y2 logic high levelM224Set Y3 logic low levelM225Set Y3 logic high levelM226Set Y4 logic low levelM227Set Y4 logic high levelM350Set the extension output logic low levelM351Set the extension output logic high levelTTool functionSSpindle speedFFeedrate	M221	Set Y1 logic high level		
M224 Set Y3 logic low level M225 Set Y3 logic high level M226 Set Y4 logic low level M227 Set Y4 logic high level M350 Set the extension output logic low level M351 Set the extension output logic high level T Tool function S Spindle speed F Feedrate	M222	Set Y2 logic low level		
M225 Set Y3 logic high level M226 Set Y4 logic low level M227 Set Y4 logic high level M350 Set the extension output logic low level M351 Set the extension output logic high level T Tool function S Spindle speed F Feedrate	M223	Set Y2 logic high level		
M226 Set Y4 logic low level M227 Set Y4 logic high level M350 Set the extension output logic low level M351 Set the extension output logic high level T Tool function S Spindle speed F Feedrate	M224	Set Y3 logic low level		
M227 Set Y4 logic high level M350 Set the extension output logic low level M351 Set the extension output logic high level T Tool function S Spindle speed F Feedrate	M225	Set Y3 logic high level		
M350 Set the extension output logic low level M351 Set the extension output logic high level T Tool function S Spindle speed F Feedrate	M226	Set Y4 logic low level		
M351 Set the extension output logic high level T Tool function S Spindle speed F Feedrate	M227	Set Y4 logic high level		
T Tool function S Spindle speed F Feedrate	M350	Set the extension output logic low level		
T Tool function S Spindle speed F Feedrate	M351			
S Spindle speed F Feedrate	T			
F Feedrate				




9.5 Tool setting(Tool measurement)

Tool setting is a process to set up a workpiece coordinate system in machine coordinate system. To put it in other words, tool setting aims to set the workpiece origin.

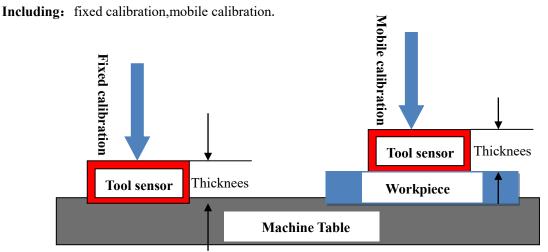

Fixed&Mobile calibration

9.5.1 Fixed calibration

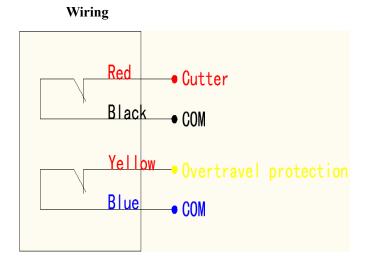






Normally open: Cutter signal connects to X4 (X5-A18),COM connects to GND-INPUT SIGNAL X4:system default normally open.

Normally closed: Firstly, modify the input level of X4 to normally closed, then connect cutter signal to X4 (X5-A18), COM to GND-INPUT SIGNAL.

Overtravel protection signal is similar to cutter signal, users can connect to X7(X8-A18)-- E-stop signal.



Fixed calibration process:

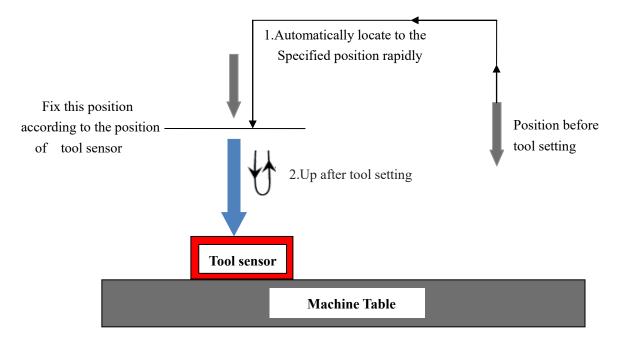

Fixed calibration refers to measurement operation at a certain fixed position on the machine.

 
During actual maching,tool length and tool holder position will change after tool change because of tool breakage or other reasons.On this occasion, users can conduct fixed calibration to re-confirm the tool length offset.

Instructions:

1) Set tool sensor position

Get into —MACHINE SETUP-C.A.D Position" to set tool sensor position,including —Inplace"&—Inposition"

Inposition: Press—", screen displays—Press OK key to set point position by manual mode, it's very simple but not accurate, press cancel to set by number". Recommend manual mode.



2) Tool setting of first time/after tool changing

1. Manual move Z axis to the surface of workpiece, and press—

XY-0

8

 
"to set workpiece



origin of X,Y,Z axis.


- MENU ONOFF

 2. Press "'+- "'to start first time tool setting. The system will record value of offset automatically.
- 3. Start to processing after first time tool setting.
- 4. If change another tool or the tool nose has a certain degree of wear and tear, press



5. Start to processing after second time tool setting, do not need press.

Sketch map of tool offset:

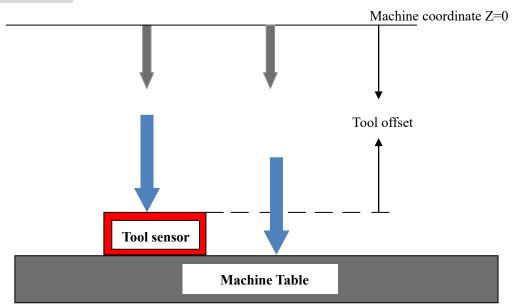

9.5.2 Mobile calibration


Mobile calibration can be used to set workpiece origin of Z axis by executing measurement at the current pisiton. This measurement type will set the workpiece offset according to the calibration result and the following calculation equation. Relationship between workpiece offset and calibration result is as shown below:

Workpiece offset=Mobile calibration result-Tool sensor thickness-Public offset-Tool offset
Generally,the factory setting value of public offset and tool offset is 0,so

Workpiece offset=Mobile calibration result-Tool sensor thickness


After mobile calibration, system will set Z axis workpiece origin automatically.



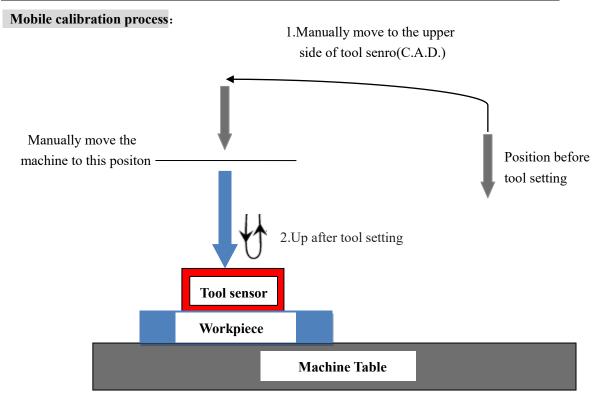

Wiring:

- 1. The white cable connects to X4 (TS,interface board)
- 2. The black cable connects to GND(Interface board)

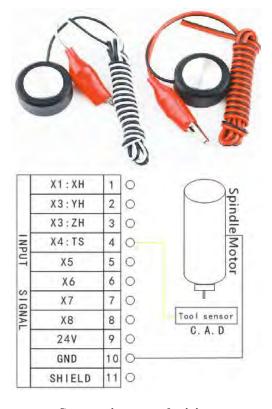

Sensor picture and wiring



Instructions:

The signal cable of tool sensor connects to X4(X5-A18), alligator clip connects to GND-INPUT SIGNAL. (alligator clip also can be cliped on the spindle if the spindle connected to GND)

Place tool sensor onto workpiece, move Z axis to the upper side of the tool sensor in manual

mode, and press — "+— " to start Z-axis automatic tool setting, the system will automatically set the workpiece origin of Z axis.

Mobile calibration usually use simple tool sensor which is affordable, easy and convenient.

Precautions:

Do not rush to make the alligator cliped to the spindle, start the function of tool setting firstly, and then use the alligator clip to touch the spindle, confirm that Z axis tool setting function is carried out normally.

C.A.D. Thickness system default is 0,user need to set it in —MACHINE SEUTP- C.A.D. Thickness"according to actual value.



9.6 Calculate pulse equivalent

9.6.1 Stepper driver

1. linear axis Unit: pul/mm

Formula = pulses per revolution / distance per revolution

Pulses per revolution formula: (360 °/stepper angle)* Driver subdivision

Some stepper drivers mark pulse number directly.

Distance/r formula:

- ► Screw drive = screw pitch*mechanical transmission ratio
- Rack (straight) drive = rack module*gear teeth number* π *mechanical transmission ratio
- Rack (helical) drive = rack module*gear teeth number*π*mechanical transmission ratio/cos
 (helical angle)
- ▶ Pulley&belt drive = π *pulley diameter*mechanical transmission ratio

✓ Screw drive:



$$pulse = \frac{\frac{360 \text{ }^{\circ}}{\text{Stepper}} \text{ } \frac{\text{angle}}{\text{angle}} * \text{Driver subdivision}}{\text{Screw pitch } * \text{transmission ratio}}$$

Pulse/rev	SW5	SW6	SW7	SW8
400	ON	ON	ON	ON
800	OFF	ON	ON	ON
1600	ON	OFF	ON	ON
3200	OFF	OFF	ON	ON
6400	ON	ON	OFF	ON
12800	OFF	ON	OFF	ON
25600	ON	OFF	OFF	ON
51200	OFF	OFF	OFF	ON
1000	ON	ON	ON	OFF
2000	OFF	ON	ON	OFF
4000	ON	OFF	ON	OFF
5000	OFF	OFF	ON	OFF
8000	ON	ON	OFF	OFF
10000	OFF	ON	OFF	OFF
20000	ON	OFF	OFF	OFF
40000	OFF	OFF	OFF	OFF

MSTEP SW5 2 ON 4 ON 8 ON 16 ON	ON OFF ON	ON ON OFF	ON ON
4 ON 8 ON 16 ON	OFF ON	ON	ON
8 ON 16 ON	ON		
16 ON		OFF	
	OFF		ON
22 011	011	OFF	ON
32 ON	ON	ON	OFF
64 ON	OFF	ON	OFF
128 ON	ON	OFF	OFF
256 ON	OFF	OFF	OFF
5 OFF	ON	ON	ON
10 OFF	OFF	ON	ON
25 OFF	ON	OFF	ON
50 OFF	OFF	OFF	ON
125 OFF	ON	ON	OFF
250 OFF	OFF	ON	OFF
DISABLE OFF	ON	OFF	OFF
DISABLE OFF	OFF	OFF	OFF

 


Driver nameplate 1

Driver nameplate 2

Motor nameplate

Screw pitch(above picture): The distance that the nut moves when the ball screw makes one rotation.



Transmission ratio: The speed ratio or angular velocity ratio of the capstan and the driven wheel.



✓ Rack drive:

► Straight rack:



$$pulse = \frac{\frac{360~^{\circ}}{Stepper~angle}}{rack~module~\times gear~teeth~number~\times \pi \times transmission~ratio}$$

► Helical rack:



$$pulse = \frac{\frac{360 \text{ }^{\circ}}{\text{Stepper angle}} \times \text{Driver subdivision } \times \text{cos (helical angle)}}{\text{rack module } \times \text{gear teeth number } \times \pi \times \text{transmission ratio}}$$

✓ Pulley&belt drive:



$$pulse = \frac{\frac{360 \, ^{\circ}}{Stepper \, angle} \times Driver \, subdivision}{\pi d \times transmission \, ratio}$$

d: pulley diameter

2. Pulse equivalent of linear axis

♦ e.g.: pulse/rev=1600, results retain up to three decimal places

Screw drive

screw pitch=5mm, pulse equivalent=
$$\frac{1600}{5}$$
 =320

Rack drive

rack module: 1.25, gear teeth number: $23,\pi$: 3.141592654, transmission ratio: 1/5(0.2)

helical angle: 19°31′42″ (≈19.52833333°)

Straight rack

pulse equivalent =
$$\frac{1600}{1.25 \times 23 \times 3.141592654 \times 0.2} = 88.573$$



Helical rack

pulse equivalent =
$$\frac{1600}{1.25 \times 23 \times 3.141592654 \times 0.2 \div \cos (19^{\circ}31^{'}42^{''})}$$
$$= \frac{1600 \times \cos (19.52833333)}{1.25 \times 23 \times 3.141592654 \times 0.2} = 83.478$$

NOTES: 1.25×23×3.141592654×0.2= 18.0641577605

 $\cos (19.52833333) = 0.94247630504668681677372940102406$

 $1.25 \times 23 \times 3.141592654 \times 0.2 \div \cos (19.52833333) = 19.1666969915 \approx 19.1667$

3. Rotation axis Unit: (pul/°)

Formula = pulses per revolution / angles per revolution (360°)



$$pulse = \frac{\frac{360 \text{ °}}{\text{Stepper angle}} \times \text{Driver subdivision}}{360 \text{ °} \times \text{transmission ratio}}$$

4. Pulse equivalent of rotation axis

 \Leftrightarrow e.g.: pulse/rev=1600,transmission ratio =1/40,results retain up to three decimal places pulse equivalent = $\frac{1600}{360 \times 1/40}$ =177.778

9.6.2 Servo driver

1. Linear axis

- ► Screw drive: pulse equivalent * screw pitch*mechanical transmission ratio
- Straigh track: pulse equivalent*rack module*gear teeth number*π*mechanical transmission ratio
- ► Helical rack: pulse equivalent * rack module*gear teeth number*π*mechanical transmission ratio/cos (helical angle)
- Pulley&belt drive: pulse equivalent π^* pulley diameter mechanical transmission ratio

2. Calculate electronic gear ratio according to fixed pulse equivalent

Pulse equivalent of handle=1000

YASKAWA- Numerator Pn20E

YASKAWA
$$\Sigma$$
—7: Encoder resolution=16777216 (2²⁴) Set **Pn20**E=16777216

YASKAWA
$$\Sigma$$
—V: Encoder resolution=1048576 (2²⁰) Set **Pn20E**=1048576



YASKAWA- Denominator Pn210

Screw drive

screw pitch=5mm, Pn210= 1000×5=5000

Rack drive

rack module: 1.25, gear teeth number: 23π : 3.141592654, transmission ratio: 1/5(0.2) helical angle: $19^{\circ}31'42''$ (\approx 19.52833333°)

♦ Straight rack

 $Pn210 = 1000 \times 1.25 \times 23 \times 3.141592654 \times 0.2 = 18064$

♦ Helical rack

 $Pn210 = 1000 \times 1.25 \times 23 \times 3.141592654 \times 0.2 \div cos (19.52833333) = 19167$

DELTA ASDA-B2&A2

B2:Encoder pulses default--N=160000, A2:Encoder pulses default--N=1280000.

e.g.B2 series N=160000

> Screw drive

screw pitch=5mm, Denominator M= $1000 \times 5 = 5000$

Electronic gear ratio =
$$\frac{N}{M} = \frac{160000}{5000} = \frac{32}{1}$$

Set P1-44=32, P1-45=1

Rack drive

rack module: 1.25, gear teeth number: $23,\pi$: 3.141592654, transmission ratio: 1/5(0.2)

helical angle: $19^{\circ}31'42'' \ (\approx 19.52833333^{\circ})$

Straight rack

Denominator M = $1000 \times 1.25 \times 23 \times 3.141592654 \times 0.2 = 18064$

Electronic gear ratio =
$$\frac{N}{M} = \frac{160000}{18064} = \frac{10000}{1129}$$

Set P1-44=10000, P1-45=1129

♦ Helical rack

Denominator M = $1000 \times 1.25 \times 23 \times 3.141592654 \times 0.2 \div \cos (19.52833333) = 19167$

Electronic gear ratio =
$$\frac{N}{M} = \frac{160000}{19167}$$

Set P1-44=160000, P1-45=19167



3. Calculate pulse equivalent according to fixed electronic gear ratio

B2: Electronic gear ratio default--16/10, A2: Electronic gear ratio default--N=128/10

e.g. B2: Set P1-44=1,P1-45=1,Encoder pulses 2500×4=10000

Screw drive

screw pitch=5mm, pulse equivalent =
$$\frac{10000}{5}$$
 = 2000

Rack drive

rack module: 1.25,gear teeth number: 23π : 3.141592654,transmission ratio: 1/5(0.2) helical angle: $19^{\circ}31'42''$ (\approx 19.52833333°)

◆ Straight rack (results retain up to three decimal places)

pulse equivalent =
$$\frac{10000}{1.25 \times 23 \times 3.141592654 \times 0.2} = 553.582$$

◆ Helical rack(results retain up to three decimal places)

pulse equivalent =
$$\frac{10000}{1.25 \times 23 \times 3.141592654 \times 0.2 \div \cos \left[0\right] (19^{\circ}31'42'')}$$
$$= \frac{10000 \times \cos \left[0\right] (19.52833333)}{1.25 \times 23 \times 3.141592654 \times 0.2}$$
$$= 521.738$$

4. Rotation axis

1) Pulse equivalent of handle fixed to 1000

YASKAWA Same to linear axis

YASKAWA
$$\sum$$
—7: **Pn20E**= 16777216,YASKAWA \sum —V: **Pn20E**=1048576 transmission ratio =1/40, **Pn210**= 1000×360×1/40=9000

DELTA Same to linear axis

DELTA ASDA-B2 Encoder pulses default--N=160000,A2 Encoder pulses default--N=1280000

e.g. B2: Denominator M=1000×360×1/40=9000, Electronic gear ratio =
$$\frac{N}{M} = \frac{160000}{9000} = \frac{160}{9}$$
, Set P1-44=160, P1-45=9.

2) Calculate pulse equivalent according to fixed electronic gear ratio, set P1-44=1, P1-45=1

Encoder pulses 2500×4=10000

pulse equivalent =
$$\frac{10000}{360 \times 1/40}$$
 =1111.111(results retain up to three decimal places)



9.6.3 Proportion calculation method

If there is an error according to the formula or no relevant data to calculate, it can be calculated according to the proportion method. Suppose handle pulse equivalent A, press "

MODE _____ switching to distance mode, set a distance B, measuring the number of actual moving distance C, then the actual pulse equivalent = $A \times B \div C$.

For example: Suppose handle pulse equivalent A = 400, f distance B = 100, actual distance C = 80, then the actual pulse equivalent = $400 \times 100 \div 80 = 500$

Repeat until you get the correct pulse equivalent.



9.7 Common problems and troubleshooting

9.7.1 Solutions of the faults display on the screen

1. Screen flicker or automatically restart

- Power supply is insufficient. Check power supply if there are problems, and change high-quality power supply to solve the problems.
- The local power grid unstable. Check local grid voltage stability, or increase the the regulator filter device.
- 3) There are something wrong with the power chip of the handle. This phenomenon also appears when the handle is powered through the USB cable to the computer, please return back the handle to our company.
- 4) Temporary solution, using standard 5V mobile phone charger, power supply through the USB cable to handle. Dual power supply, can temporary emergency use.

2. Fail to set work origin

- The buttons are broken. SYSTEM SETUP-Buttons Check,to check the buttons are normal or not.

3. Assertion error

Assertion error occurred during the processing or after starting, Is generally a software problem, you can boot assertion emergency recovery, or re-upgrade, if you need to or can not recover Depot Repair

4. Do not read U-disk or errors occurred

- 1) Processing by U-disk, screen shows—There is no item in this direction". Format U-disk to FAT32, allocation unit change to the default configuration size.
- 2) Recommend U-disks of 2G \ 4G \ 8G
- 3) There is something wrong with U-disk interface or U-disk is broken, change new U-disk or interface.
- 4) If the connection to U-disk interface is intermittent, users can copy files into inner.
- 5) Program containing the non-standard G code, or some illegal characters, the system read here,



does not recognize, interrupt handling. Recommend using professional simulation software to view the program whether there is an illegal character. Delete all illegal characters.

9.7.2 Faults in practical operation

1. The file size does not match the size of the actual set

- 1) Pulse equivalent is wrong.
- 2) You does not select the right tool.
- 3) Check the processing file.

2. The screen displays" beyond limit "druing processing

- 1) The machine is not carried back to zero, the system is not able to confirm the actual position. Make the machine back to zero.
- 2) After setting the working origin, the reserved range is less than the actual file size. Confirm the actual file size and set correct working origin.
- You set the wrong working origin in the file. Check the path of the file, and re-export the correct file.

3. Hard limit false triggering

- 1) System has connected with hard limit signal: maybe hard limit switch is broken or voltage setup X6(X7-A18) is wrong.
- System has not connected with hard limit signal: confirm that whether connect other signal to hard limit X6(X7-A18),if not,check voltage setup normal or not,if normal,MACHINE SETUP-Input Confi-disable X6(X7-A18), then wipe cache and system upgrade.

4.Z axis (spindle) fall down abnormally (too fast) during processing

- Working speed beyond the fastest speed of Z axis. "MACHINE SETUP" "Max Spd Limit", set the safe speed.
- 2) Coupling is loosing or transmission slippages. Re-adjustment the connecting parts.
- 3) The lines connect the interface board with the motor drivers has disruption. Re-adjust the lines.
- Processing file error. Check processing file, try to download the correct processing file to U
 disk or handle internal.
- 5) There is something wrong with the lines connectting Z axis motor and motor driver. Replace the lines.



5. Repeating the same processing file after backing to the machine origin, Z axis depth is not the same

- Machining countertop is uneven or processing object not firmly fixed, re-milling countertop adjust the flatness.
- 2) Z-axis origin detection switch repeat positioning accuracy error, causing each Z axis homing error. Replace a high-quality detection switch.
- 3) Too much interference in the Z-axis homing process to form a false origin. Re-adjust the cable.

6. The machine can not stop after backing to the machine origin

Double press "MENU _ " to check input signal.

- 1) The origin detection switch is broken. Replace a new one.
- 2) The distance of the origin detection switch detection sheet beyond the detection range of the switch, adjust the position of the test piece.
- 3) The origin detection switch to the interface board wiring aging or loosening. Check the connections again.
- 4) The interface board is broken. Depot Repair.
- 5) 50-pin data cable is broken. Replace it with a new data cable.

7. The machine moves to the reverse direction when backing to the machine origin

- 1) The origin detection switch types do not match with the definition of the corresponding level. Modify the level. (Normally open type corresponds to a level defined the direction of the arrow down, normally closed type corresponds to the level defined arrow up).
- 2) The origin detection switch is broken. Replace a new one.
- 3) The origin detection switch connects interface board not well. Refresh the cable to confirm the wiring is correct.
- 4) Too much interference, resulting in the illusion of the detection switch has been triggered. Recalibrated the whole circuit.
- 5) The interface board is broken. Depot Repair.
- 6) 50-pin data cable is broken. Replace the data cable.



8. Abnormally working when processing or the actual file is different from theoretical file

- 1) The system disorder.
- Too much external interference.Refresh connection. (Separate low voltage from high voltage,"GND" of inverter separated from the other components).
- 3) There is something wrong during the process of ENG change to NC.

9. Start automatic tool setting, the tool does not stop after touching C.A.D(Tool sensor).

- 1) Cutter signal cable connects X4(X5-A18) not well.
- The "GND" terminal of interface board does not connect with spindle shell or connect not well.
- 3) MACHINE SETUP-Input Confi, confirm that X4(X5-A18) enable.

10. Coordinate value changes changes, the machine does not move

- 1) If one axis is not moving, it may be a connection problem. Change another normal terminal to this terminal, if it is ok, the motor dirver is ok. Maybe there is something wrong with interface board 50-pin cable. If it is still not moving, it is necessary to detect the corresponding drive and motor.
- 2) If all axises are not moving ,firstly check if there are problems in the 50-pin cable and interface, secondly check the power supply of the motor drivers.
- 3) Check the mechanical parts.

11. It is normal to the move from one position to another position, but when return from that position to the original position is not normal

Mechanical problems, screw may install not well.

12. Direction of movement is wrong

- 1) Exchange A+&A-/B+&B- cable of stepper motor
- 2) Change motor direction mask(not recommended)

13. The machine vibrates when arc or two-axis linkage movement

- 1) Check whether the machine is placed horizontally,
- 2) Check coupling member loose or not.
- 3) Increasing the start speed, avoid the resonance point.



9.7.3 Electrical components and wiring problem

1. One axis or multi-axis only one-way movement after handle power up

- 1) There is something wrong with the cable connect the interface board with the motor driver, check the connection.
- 2) Interface board is broken. Replace the interface board.
- 3) The motor driver is broken. Replace the driver.
- 4) Measure the direction voltage of the axis with a multimete.

2. One axis motor does not move after handle power up

- 1) Pulse cable and direction cable connect oppositely, rewiring it.
- 2) 5V common anode end of the motor driver disconnected, check the connection.
- 3) The motor driver is broken, change to a new one.
- 4) The chip of the interface board is broken, no pulse signal output.
- 5) Change this terminal to another normal termina to check interface board abnormal or driver abnormal.

3. Screen is not bright after power up, and connected handle to computer with a USB cable the screen displays normal

- The handle does not connect to power supply. Check DC24V power supply output normal or not, if normal, please check the cable from the power supply to the interface board.
- 2) The 50-pin cable is broken or the interface is broken.

4. Screen is not bright after power up, and connect the handle to computer by USB cable, the screen is also not bright

- This phenomenon may due to the handle shocked by external force or fall on the ground, causing the crystal processor broken. Depot Repair.
- 2) Users connect high voltage power supply. Depot Repair.

5. The screen display "Spindle on", actually the spindle off, the screen display "Spindle off", actually the spindle on

- 1) There is something wrong with cables. Check cables.
- 2) The output level definition is wrong. Modify correct output level definition.

6. System always alarm after the alarm signal has been connected

Change the input level of X5(X6-A18) (normally open ,wiring in parallel, normally closed,

wiring in series)

7. Press spindle on, but spindle does not start

- 1) Check wiring, if normal, check interver and spindle motor.
- 2) Check 50-pin cable.



3) Check interface board.Press — " to start spindle,use multimeter to measure Y1 and GND whether conducting,if not,maybe interface or 50-pin cable is broken.